



# EX-TRAFIRE<sup>®</sup> 105HD

## Plasma Cutting System

Operating Instructions - EX-5-902-004/N21609 - CE

Revision 2, 2nd February, 2023

**THERMACUT<sup>®</sup>**  
THE CUTTING COMPANY<sup>®</sup>

## Table of contents

<b>1</b>	<b>Identification .....</b>	<b>EN-5</b>
1.1	Marking.....	EN-5
1.2	Identification plate .....	EN-5
1.3	Signs and symbols used.....	EN-5
1.4	Classification of the warnings .....	EN-6
<b>2</b>	<b>Safety.....</b>	<b>EN-6</b>
2.1	Designated use.....	EN-6
2.2	Obligations of the operator .....	EN-7
2.3	Warning and notice signs.....	EN-7
2.4	Product-specific safety instructions.....	EN-7
2.5	Safety instructions for the electrical power supply .....	EN-8
2.6	Safety instructions for plasma cutting.....	EN-8
2.7	Personal protective equipment .....	EN-8
2.8	Emergency information .....	EN-8
<b>3</b>	<b>Scope of delivery.....</b>	<b>EN-9</b>
<b>4</b>	<b>Product description .....</b>	<b>EN-10</b>
4.1	Assembly and use .....	EN-10
4.2	Technical data .....	EN-11
4.3	Technical data for cutting torches FHT-EX® 105TTH and FHT-EX® 105TTM.....	EN-12
<b>5</b>	<b>Transport and positioning .....</b>	<b>EN-14</b>
<b>6</b>	<b>Setting up the power supply .....</b>	<b>EN-15</b>
6.1	Connecting to the gas supply.....	EN-15
6.2	Connecting the work lead.....	EN-15
6.3	Connecting the power supply cable .....	EN-15
6.4	Connecting the input power plug.....	EN-16
6.4.1	Connection to a generator (optional).....	EN-16
6.5	Connecting the cutting torch.....	EN-17
6.6	Connecting the CNC interface .....	EN-17
6.6.1	Setting the DIP switches .....	EN-18
6.6.2	Enabling the external DC coil with an external power supply .	EN-19
6.6.3	Enabling the external AC coil with an external power supply..	EN-19
6.6.4	Enabling the industrially insulated module with an external power supply .....	EN-20
6.6.5	Installing the cutting torch's gear rack .....	EN-20
6.7	Installing consumables for the hand and machine cutting torches.....	EN-21
6.8	Aligning FHT-EX® 105TTM machine cutting torch.....	EN-23
<b>7</b>	<b>Operation of the power supply .....</b>	<b>EN-23</b>
7.1	LCD description.....	EN-24
7.1.1	Setting the parameters .....	EN-25
7.1.2	Selecting the cutting mode.....	EN-25
7.1.3	Connecting the work lead with the work lead clamp .....	EN-26
7.2	Powering on the machine .....	EN-26
7.3	Manual cutting process .....	EN-26
7.4	Manual grid cutting, gouging, marking process.....	EN-27
7.5	Cutting .....	EN-27
7.6	Piercing.....	EN-28

7.7	Gouging .....	EN-29
7.7.1	Table for FHT-EX®105TT material removal .....	EN-29
7.8	Stopping the cutting process .....	EN-30
<b>8</b>	<b>Disconnecting the unit.....</b>	<b>EN-30</b>
<b>9</b>	<b>Maintenance and cleaning.....</b>	<b>EN-30</b>
9.1	Maintenance and cleaning intervals .....	EN-31
<b>10</b>	<b>Faults and troubleshooting.....</b>	<b>EN-32</b>
<b>11</b>	<b>Disassembly .....</b>	<b>EN-37</b>
<b>12</b>	<b>Disposal .....</b>	<b>EN-38</b>
12.1	Disposal of materials.....	EN-38
12.2	Disposal of consumables .....	EN-38
12.3	Packaging .....	EN-38
<b>13</b>	<b>Warranty .....</b>	<b>EN-39</b>
<b>14</b>	<b>Block diagram .....</b>	<b>EN-40</b>
<b>15</b>	<b>Accessories .....</b>	<b>EN-40</b>
<b>16</b>	<b>FHT-EX® 105TTH hand cutting torch unit.....</b>	<b>EN-41</b>
<b>17</b>	<b>FHT-EX® 105TTH consumables for hand cutting torch.....</b>	<b>EN-42</b>
17.1	FHT-EX® 105TTH consumables for hand cutting torch 45 - 85 A.....	EN-42
17.2	FHT-EX® 105TTH consumables for hand cutting torch 100 - 105 A .....	EN-43
17.3	FHT-EX® 105TTH consumables for SmoothLine hand cutting torch.....	EN-43
<b>18</b>	<b>FHT-EX® 105TTM machine cutting torch unit .....</b>	<b>EN-44</b>
18.1	FHT-EX® 105TTM machine cutting torch without gear rack.....	EN-44
18.2	FHT-EX®105TTSM short machine cutting torch .....	EN-45
<b>19</b>	<b>FHT-EX® 105TTM consumables for machine cutting torch.....</b>	<b>EN-46</b>
19.1	FHT-EX® 105TTM consumables for standard machine cutting torch 45 - 85 A.....	EN-46
19.2	FHT-EX® 105TTM consumables for standard machine cutting torch 100 - 105 A .....	EN-47
19.3	FHT-EX® 105TTM consumables for SmoothLine machine cutting torch.....	EN-48
19.4	FHT-EX® 105TTM consumables for marking machine cutting torch.....	EN-49
<b>20</b>	<b>Ordering information on bulk packs and starter kits</b>	<b>EN-50</b>
<b>21</b>	<b>Cutting tables for mechanical cutting.....</b>	<b>EN-51</b>
21.1	45 A cutting, shielded, with compressed air .....	EN-52
21.2	55 A cutting, shielded, with compressed air .....	EN-53

21.3	65 A cutting, shielded, with compressed air .....	EN-54
21.4	75 A cutting, shielded, with compressed air .....	EN-55
21.5	85 A cutting, shielded, with compressed air .....	EN-56
21.5.1	185 A cutting, shielded, with compressed air .....	EN-57
21.6	100 - 105 A cutting, shielded, with compressed air .....	EN-58
21.6.1	1100 - 105 A cutting, shielded, with compressed air .....	EN-59
21.7	40 - 45 A cutting, SmoothLine, shielded, with compressed air	EN-60
21.7.1	140 - 45 A cutting, SmoothLine, shielded, with compressed air	EN-61
21.8	Tables for marking.....	EN-62
21.8.1	Marking, shielded, with compressed air or argon .....	EN-62

## 1 Identification

The EX-TRAFIRE® 105HD is a portable cutting power supply for mechanized and manual plasma cutting, gouging, and marking. The EX-TRAFIRE® 105HD uses gas or nitrogen to cut almost all conductive metals. The device may be operated only with original Thermacut® parts. This documentation describes the EX-TRAFIRE® 105HD cutting power supply only.

When used in this documentation, the term “device” always refers to the EX-TRAFIRE® 105HD cutting power supply.

### 1.1 Marking

This product fulfills the requirements that apply to the market to which it has been introduced. A corresponding marking has been affixed to the product, if required.

### 1.2 Identification plate

Fig. 1 EX-TRAFIRE® 105HD identification plate

IDENTIFICATION			
<b>THERMACUT®</b> THE CUTTING COMPANY®		Sokolovska 574, 686 01 Uherske Hradiste, Czech Republic, tel.: +420 572 420 411 email: reditelstvi@thermacut.cz	
<b>EX-TRAFIRE® 105HD</b>			
		EN IEC 60974-1 EN 60974-10	
Order : EX-5-003-001			
Serial :			
OUTPUT			
	U <sub>n</sub> =400V±15%	Output 20A/88V-105A/180V	
	---	X	100%
	U <sub>0</sub> =330V	I <sub>z</sub>	105A
		U <sub>z</sub>	180V
	U <sub>n</sub> =400V±15%	Output 20A/108V-105A/180V	
	---	X	100%
	U <sub>0</sub> =330V	I <sub>z</sub>	105A
		U <sub>z</sub>	180V
ENERGY INPUT			
	U <sub>i</sub> =400V	I <sub>max</sub> =39A	I <sub>nom</sub> =39A
	3-50/60Hz	IP23	F

The device is labeled by means of an identification plate on the housing located under the machine.

- For inquiries, please have at hand the device type and device number per the identification plate.

### 1.3 Signs and symbols used

The following signs and symbols are used:

- General instructions.
- 1 Action(s) to be carried out in succession.
- Lists.
- ⇒ Cross-reference symbol refers to detailed, supplementary or further information.
- A** Caption, item description.

## 1.4 Classification of the warnings

The warnings are divided into four different categories and are indicated prior to potentially dangerous work steps. The following signal words are used depending on the type of hazard:

### **DANGER**

Describes an imminent threatening danger. If not avoided, it may cause severe injury or death.

### **WARNING**

Describes a potentially dangerous situation. If not avoided, this may result in serious injury or death.

### **CAUTION**

Describes a potentially harmful situation. If not avoided, this may result in slight or minor injury.

### **NOTICE**

Describes the risk of impairing work results or material damage and indicates irreparable damage to the device or equipment.

## 2 Safety

This chapter warns of hazards that should be kept in mind to operate the product safely. Non-observance of the safety instructions may result in risks to the life and health of personnel, environmental damage or material damage.

- Observe the document entitled "Safety Instructions".

### 2.1 Designated use

The device described in this document may be used only for the purpose and manner described. The device is used only for the generation and control of the output current required for plasma cutting, gouging, and marking. Any other use is considered improper. Unauthorized modifications or changes to enhance the performance are not permitted.

- Do not exceed the maximum load data as defined by the document supplied. Overloads lead to destruction.
- Do not make any modifications or changes to this product.
- Do not use the device to thaw pipes.
- Do not use or store the device outdoors where it is wet.

## 2.2 Obligations of the operator

- Ensure that only qualified personnel are permitted to work on the device or system.

Authorized personnel are:

- those who are familiar with the basic regulations on occupational safety and accident prevention;
  - those who have been instructed on how to handle the device;
  - those who have read and understood these operating instructions;
  - those who have been trained accordingly;
  - those who are able to recognize possible risks because of their special training, knowledge, and experience.
- Keep untrained persons out of the work area.
  - Each time the device's cover plates are opened, have Thermacut® or another authorized specialist perform a safety inspection in accordance with DIN IEC 60974 Part 4: "Periodic inspection and testing".

The device can produce electromagnetic fields that could impact the proper function of cardiac pacemakers and implanted defibrillators.

- Do not use the device if you have a pacemaker or an implanted defibrillator.

This Class A cutting device is not intended for use in residential areas with a public low-voltage power supply system. It can potentially be difficult to guarantee electromagnetic compatibility in these areas due to both conducted and emitted interference.

- The device may be used only in industrial zones according to DIN EN 61000-6-3.

## 2.3 Warning and notice signs

The following warning, notice and mandatory signs can be found on the product:



- Read and observe the operating instructions.

These markings must always be legible. They may not be covered, obscured, painted over, or removed.

## 2.4 Product-specific safety instructions

- Do not use or store the device outdoors where it is wet.
- Do not operate the device if the housing is open.

## 2.5 Safety instructions for the electrical power supply

- Ensure that the input power cable is not damaged, for example, by being driven over, crushed or torn.
- Check the input power cable for damage and wear at regular intervals.
- If it is necessary to replace the input power cable, only models indicated by the manufacturer may be used.
- Only a qualified electrician should carry out work on the input power cable and the input power plug.
- Water protection and mechanical stability must be ensured when replacing the input power plug of the input power cable.

## 2.6 Safety instructions for plasma cutting

- Plasma cutting may cause damage to the eyes, skin, and hearing. Note that other hazards may arise when the device is used with other cutting components. Therefore, always wear the prescribed personal protective equipment as defined by local regulations.
- All metal vapors, especially lead, cadmium, copper, and beryllium, are harmful. Ensure sufficient ventilation or extraction. Do not exceed the current occupational exposure limits (OEL).
- To prevent the formation of phosgene gas, rinse workpieces that have been degreased with chlorinated solvents using clean water. Do not place degreasing baths containing chlorine in the vicinity of the cutting area.
- Adhere to the general fire protection regulations and remove flammable materials from the vicinity of the cutting work area prior to starting work. Provide appropriate fire extinguishing equipment in the workplace.

## 2.7 Personal protective equipment

- Wear your personal protective equipment (PPE).
- Ensure that others in close proximity are also wearing personal protective equipment.

Personal protective equipment consists of protective clothing, safety goggles, face protection, ear protectors, protective gloves, and safety shoes.

## 2.8 Emergency information

- In the event of an emergency, immediately disconnect the following supplies:
  - Electrical power supply
  - Gas supply



### 3 Scope of delivery

The following components are included in the scope of supply:

- 1× EX-TRAFIRE®105HD cutting power supply
- 1× FHT-EX®105TTH or FHT-EX®105TTM cutting torch
- 1× work lead incl. workpiece clamp
- 1× operating instructions
- 1× “Safety Instructions” document
- 1× “Warranty” document
- 1× operating instructions for the cutting torch
- 1× starter kit
- Order the equipment parts and consumables separately.
- The order data and ID numbers for the equipment parts and consumables can be found in the product catalog.
- For more information about points of contact, consultation, and orders, visit [www.thermacut.com](http://www.thermacut.com).

Although the items delivered are carefully checked and packaged, it is not possible to fully rule out the risk of transport damage.

#### Goods-in inspection

- Check for order completeness by checking the delivery note.
- Check the delivered goods for damage (visual inspection).

#### Claim process

- If goods are damaged, notify the final carrier.
- Keep the packaging for possible inspection by the carrier.

#### Returns


- Use original packaging and packing material for returns.
- If you have questions concerning the packaging or how to secure the device, contact your supplier, carrier or transport company.

## 4 Product description

### 4.1 Assembly and use

The control elements are located on the control panel. The connections are on the front and rear of the device.

**Fig. 2** Control elements and connections

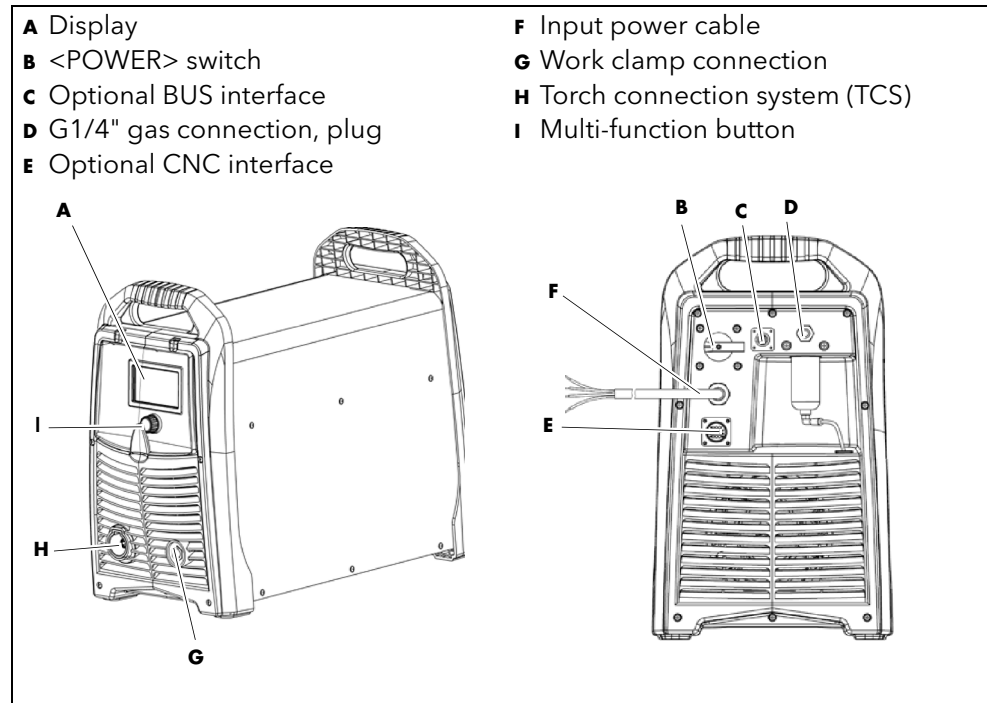

<b>Digital display (A)</b>	Displays the device status. A fault code is displayed if an error occurs.
<b>&lt;POWER&gt; switch (B)</b>	Used to switch the device on and off.
<b>BUS interface (C)</b>	For connecting the optional CAN BUS or RS485/422 BUS.
<b>CNC interface connection (E)</b>	This optional interface is used to connect the device to an optional CNC cutting table or robot.
<b>Multi-function button (I)</b>	For toggling between two menus and setting the cutting parameters.

## 4.2 Technical data

Table 1 Power supply specifications

	CE	
Idle voltage ( $U_0$ )	330 V DC	
Characteristic curve* * The curve is defined as output voltage versus output current	Drooping	
Output current ( $I_2$ )	20 - 105 A	
Nominal voltage ( $U_2$ )	180 V DC	
Output current at 100% duty cycle ( $I_2$ )	105 A	
Maximum power input	27.1 kVA	
Duty cycle ( $X^*$ ) at 40°C under nominal conditions ( $U_1, I_1, U_2, I_2$ ) * $X = t_{on}/t_{base}$ $t_{on}$ = time, minutes $t_{base}$ = 10 minutes	$U_{rms}$	100%
Ambient temperature	-10°C to +40°C	
Input voltage ( $U_1$ )	400 VAC $\pm$ 15% 3 PH/50 - 60 Hz	
Rated input current ( $I_{1rms}$ ) and effective input current ( $I_{1eff}$ ) at rated output voltage ( $U_2$ ) and rated output current ( $I_2$ ) - only for cutting mode. eff = effective rms = root mean square	$I_{rms}$	$I_{eff}$
	39 A	39 A
	Complies with standards IEC 60974-1, IEC 60974-10	
Insulation class	F	
Protection type	IP23S	
Tilt angle (with or without wheels)	Up to 15°	
Dimensions (L x H x W) [mm]	613 x 515 x 302	
Weight (kg)	35.4	

Table 2 Ambient conditions for transport and storage

Ambient temperature	- 20°C to +55°C
Relative humidity	< 50% at +40°C < 90% at +20°C

Table 3 Ambient conditions for operation

Ambient temperature	- 10°C to +40°C
Relative humidity	< 50% at +40°C < 90% at +20°C
Installation above sea level	Max. 2000 m
Tilt angle	Up to 15°

Table 4 Gas data

Permissible gas	Compressed air/nitrogen
Max. gas inlet pressure	10 bar
Recommended compressed air quality	ISO 8573-1 class 1.2.2. Purity: $\geq 99.99\%$ clean, and free from moisture and oil
Max. flow rate	205 l/min at 5 bar

#### 4.3 Technical data for cutting torches FHT-EX® 105TTH and FHT-EX® 105TTM

FHT-EX® cutting torches are used for manual and mechanical cutting, gouging, and marking. They use compressed air or nitrogen to cut mild steels, stainless steels, aluminum, and other electrically conductive metals. They are connected to the cutting power supply using the Torch Connection System (TCS).

➤ The values below refer to the torches.

Table 5 Technical data for FHT-EX® 105TTH and FHT-EX® 105TTM cutting torches

	FHT-EX® 105TTH / FHT-EX® 105TTM
Recommended cutting capacity [mm]	35
Max. cutting capacity [mm]	50
Separating cut capacity [mm]	50
Piercing capacity [mm]	25
Permissible ambient temperature during operation	-10°C to +40°C
Permissible ambient temperature during transport and storage	-25°C to +55°C
Relative humidity	< 90% at +20°C
Sub-menu item	Plasma cutting, gouging, marking
Application type	Hand and machine
Rated current and duty cycle	105 A/100%
Permissible gas	Compressed air/nitrogen
Flow rate	100 A/105 A approx. 156 l/min. at 4.8 bar
	75 A/85 A approx. 101 l/min. at 5.2 bar
	55 A /65 A approx. 87 l/min. at 5.2 bar
	45 A approx. 82 l/min. at 5.2 bar
Flow rate for gouging	100 A/105 A approx. 205 l/min. at 5 bar
	65 - 85 A approx. 195 l/min. at 5 bar
Flow rate for marking	10, 11, 12, 15, 16 A approx. 39 l/min. at 2.4 bar
Maximum inlet pressure	10 bar
(Dynamic) operating pressure	5.2 bar
Gas post-flow period delay	$\geq 20$ seconds

**Table 5** Technical data for FHT-EX® 105TTH and FHT-EX® 105TTM cutting torches

	<b>FHT-EX® 105TTH / FHT-EX® 105TTM</b>
Type of voltage	DC
Protection type for device	IP23S (EN 60529)
Connection type	TCS (torch connection system) - 13 pin
Standard lengths (other lengths available upon request)	5 m/8 m/15 m/23 m

**Table 6** Cutting torch weights and cable lengths

<b>Cutting torch</b>	<b>Weight and cable lengths</b>
FHT-EX® 105TTH Standard hand cutting torch	5 m / 2.5 kg 8 m / 3.3 kg 15 m / 5.0 kg 23 m / 7.9 kg
FHT-EX® 105TTM STD-NR Standard machine cutting torch, without rack	5 m / 2.1 kg 8 m / 3.4 kg 15 m / 5.7 kg 23 m / 8.0 kg
FHT-EX® 105TTSM Short machine cutting torch	5 m / 2.0 kg 8 m / 3.4 kg 15 m / 5.7 kg 23 m / 8.0 kg

## 5 Transport and positioning

### **⚠ WARNING**

#### **Risk of injury due to improper transport and installation**

Improper transport and installation can cause the device to tip or fall over. This may result in serious injury.


- Wear your personal protective equipment.
- Ensure that all supply lines and cables do not encroach into the area in which employees are working.
- Place the device on a suitable surface (flat, solid, and dry) on which it will not topple over, taking into account the max. tilt angle of 15°.
- Note the weight of the device when lifting it.  
⇒ 4.2 Technical data on page EN-11
- Use an appropriate lifting tool with load handling equipment for transporting and installing the device.
- Avoid abrupt lifting and setting down.
- Do not lift the device over individuals or other devices.
- Use the attachment points provided.

### **NOTICE**

#### **Risk of material damage due to improper transport and installation**

Improper transport or installation can cause the device to tip or fall over. This can result in material damage and irreparable damage to the device.


- Protect the device against weather conditions, such as rain and direct sunlight.
- Protect the device from spatter when cutting.
- Protect the device from direct exposure to sparks when grinding.
- Use the device only in dry, clean, and well-ventilated rooms.
- Maintain a minimum distance of 1 m from the wall when positioning the device to ensure that it has sufficient ventilation.

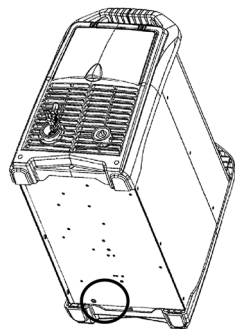

- When positioning the device, make sure that the water separator's drain opening is not covered.


## 6 Setting up the power supply

### 6.1 Connecting to the gas supply

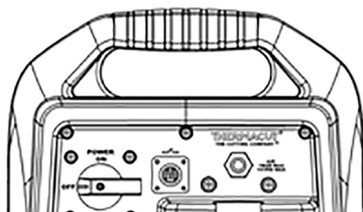


- Connect the gas hose with an inside diameter of at least 6 mm to the gas connection of the device.

### 6.2 Connecting the work lead

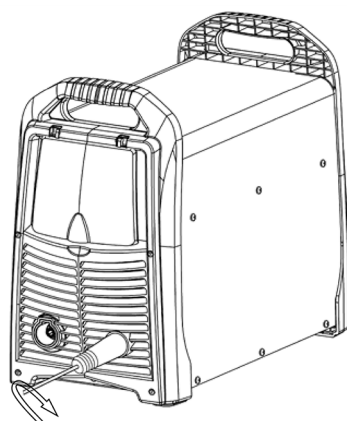

- Connect the work lead to the work lead connecting socket and secure it by rotating clockwise.

### 6.3 Connecting the power supply cable

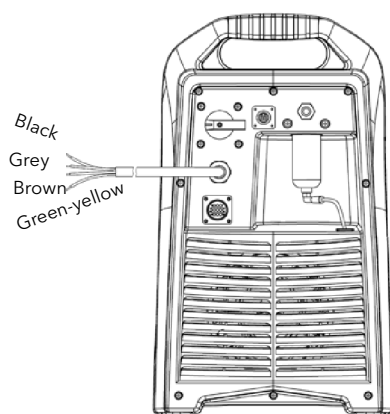

- The power supply should be connected by a qualified electrician.
- L1 -> black (U)
- L2 -> brown (V)
- L3 -> gray (W)
- PE grounding -> green-yellow

**Table 7** Recommended cable extensions

Input voltage	Wire cross-sections	Length
400 V AC/3 phases	6 mm <sup>2</sup>	Up to 15 m
	10 mm <sup>2</sup>	15 - 45 m

## 6.4 Connecting the input power plug

- Note the safety instructions.
  - ⇒ 2.5 Safety instructions for the electrical power supply on page EN-8

### **⚠ WARNING**

#### **Electric shock due to improperly installed electrical power supply**

If the electrical power supply and grounding are improperly installed, fatal electric shock may occur.

- If you want to operate the device in a very humid environment or on conductive material, install a ground fault circuit interrupter (GFCI) in the power supply.
- Use a slow-blow GFCI fuse.
- Protect the power supply line to the device with suitable fuses that comply with regulations.
- Ground the device according to the applicable regulations.
- Do not ground the device together with other devices or machines.

### **⚠ WARNING**

#### **Risk of electric shock due to improperly installed or defective cables**

Damaged or improperly installed cables can lead to fatal electric shock.

- Check all live cables and connections for proper installation and damage.
- Damaged, deformed or worn parts should only be replaced by a qualified electrician.

### **⚠ WARNING**

#### **Risk of injury due to fire**

Improper use or connection can result in fire. This may result in serious injury.

- Ensure that the operating voltage specified on the identification plate is suitable for the input voltage.

For the input voltage and the fuse protection, please refer to:

⇒ 4.2 Technical data on page EN-11

- If necessary, have a qualified electrician connect the input power cable extension in accordance with local regulations.
- Ensure that the power supply is adequately protected by a safety switch.
- Insert the input power plug of the power cable into the corresponding socket.

### 6.4.1 Connection to a generator (optional)

- Set the generator to three-phase alternating current.
- Plug the input power plug into the socket.
- Set the motor rating as shown in the following table.

**Table 8** Connection to a generator

<b>Generator motor rating</b>	<b>Output current (I<sub>2</sub>)</b>	<b>Arc voltage</b>
≥ 30 kW	105 A	U <sub>2</sub> = 200 V DC



## 6.5 Connecting the cutting torch


### NOTICE

#### Risk of material damage if used without TCS Latch with Key Assembly


The TCS Latch with Key Assembly is important for the proper working of the machine. If used without, the device may be irreparably damaged.

- Do not use the device without the TCS Latch with Key assembly installed and properly secured.


➤ Switch off the power supply.

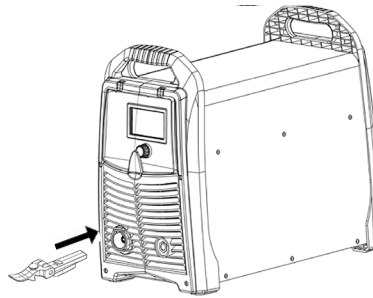

- 1 Insert the TCS Latch with Key Assembly into the TCS socket.

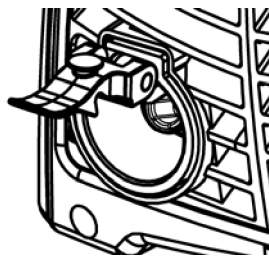

➤ The TCS Latch with Key Assembly must sit firmly in the TCS socket.

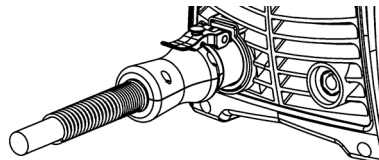

- 2 Push the cutting torch into the TCS and ensure the Latch with Key Assembly locks in place.

## 6.6 Connecting the CNC interface

The CNC interface is on the rear of the device. Control signals can be transmitted via the CNC interface. The signal types can be found in the table. The control elements are located on the control panel. The connections are on the front and rear of the device.

⇒ 4.1 Assembly and use on page EN-10

### ⚠ WARNING

#### Electric shock due to live parts

Live parts are exposed when the housing is open. This can result in fatal electric shock.

- Set the <POWER> switch to <OFF> and disconnect the input power plug before opening the housing.

Fig. 3 Pin assignment for CNC interface

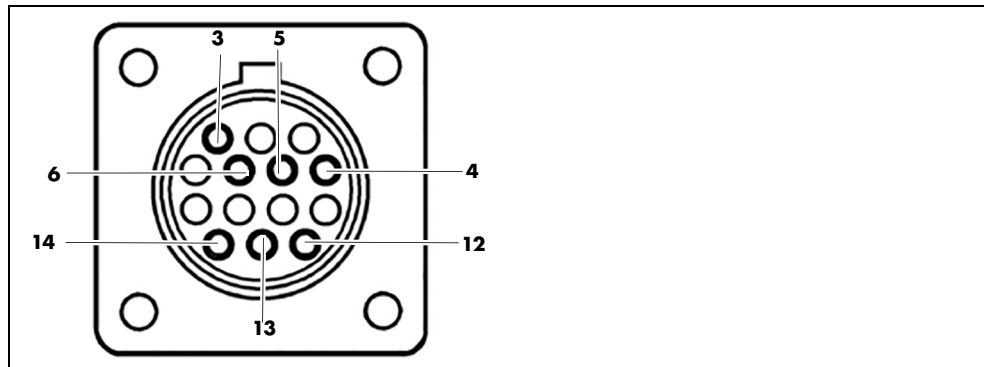


Table 9 Pin assignment


Signal	START	Arc	PE	Voltage divider
	Start plasma cutting	Start feeding		
Type	Input	Output	PE	Output
Notice	Open by default. Requires potential-free contact to close.	Open by default. Potential-free with max. capacity of: 120 V AC/1 A		Reduced arc signal: 20:1 21.1:1 30:1 40:1 50:1 (supplies max. 18 V)
PIN	3, 4	12, 14	13	6 (+), 5 (-)
Internal cable color	White, white	Yellow, yellow	Green/yellow	6 (red), 5 (black)

### 6.6.1 Setting the DIP switches

The DIP switches are preset to 50:1.

- 1 The housing must be opened only by a qualified electrician.
- 2 The DIP switches must be set only by a qualified electrician.  
⇒ Fig. 4 DIP switch settings on page EN-18
- 3 The housing must be closed only by a qualified electrician.
- 4 Have a safety inspection performed in accordance with DIN IEC 60974 Part 4: "Periodic inspection and testing" by Thermacut® or another authorized specialist.


Fig. 4 DIP switch settings

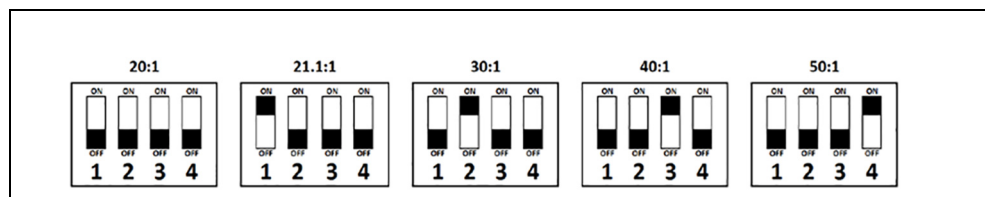

### 6.6.2 Enabling the external DC coil with an external power supply


➤ For 24 V DC, use a 1N4007 diode.

**Fig. 5** Enable the external DC coil with an external power supply.

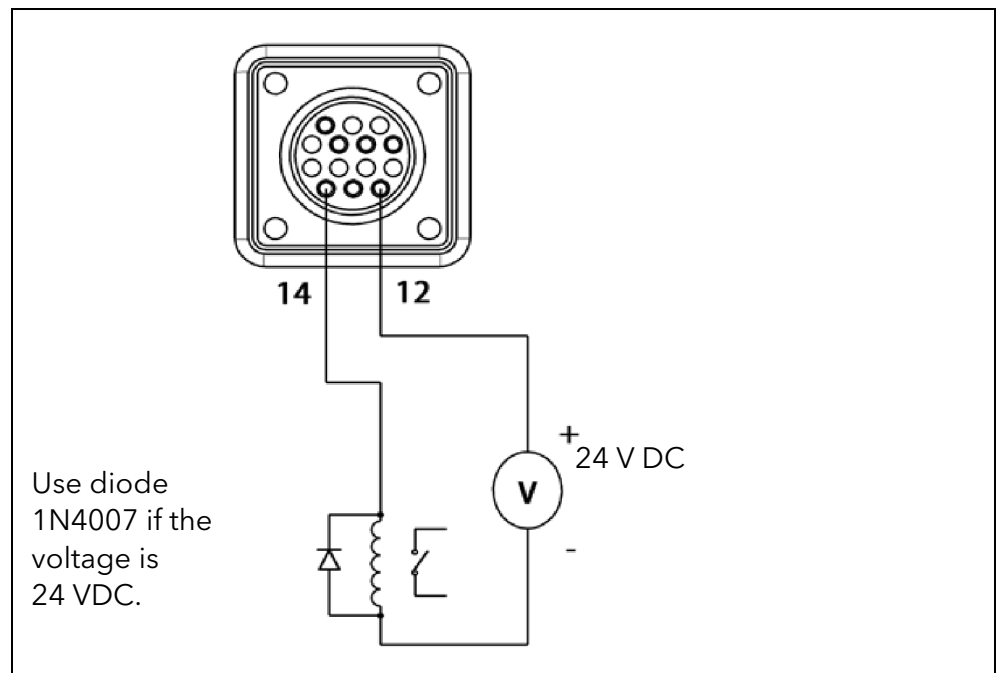


### 6.6.3 Enabling the external AC coil with an external power supply

**Fig. 6** Enable the external AC coil with an external power supply.

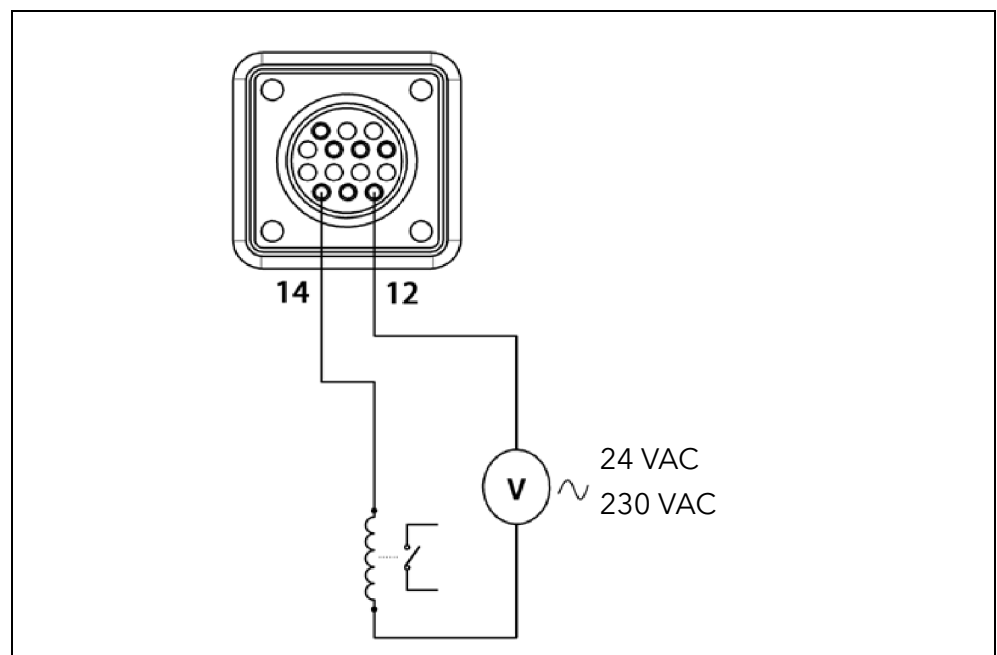

### 6.6.4 Enabling the industrially insulated module with an external power supply


Industrially insulated user module with 24 V DC power supply.

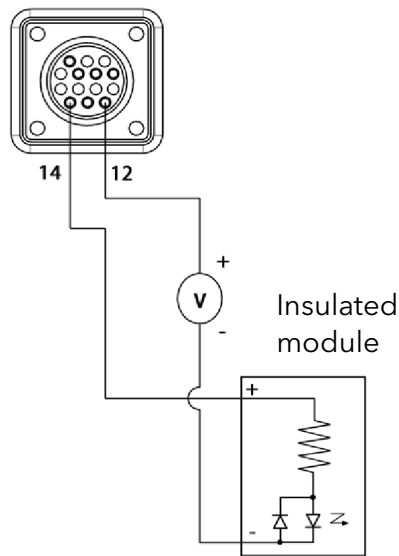


- 1 Switch off the device.
- 2 Remove the interface cover.
- 3 Connect the interface cable with the cutting power supply.

### 6.6.5 Installing the cutting torch's gear rack

Fig. 7 Cutting torch

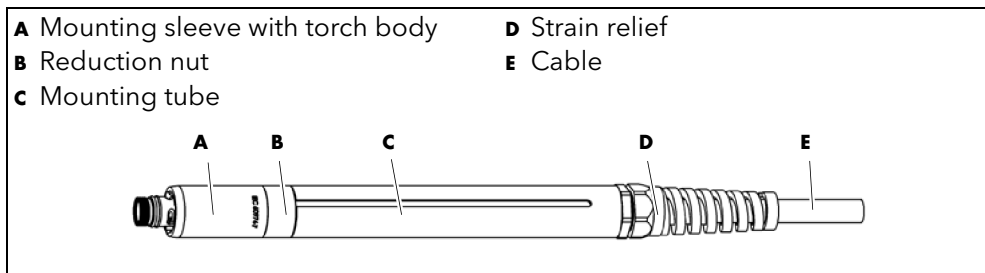

- 1 Disconnect the machine cutting torch from the cutting power supply.
  - 2 Place on a flat surface.
  - 3 Unscrew the strain relief so that it can move freely along the torch cable.
  - 4 Unscrew the mounting tube from the reduction nut. Hold the reduction nut and the mounting sleeve in order not to damage the cables.
  - 5 Carefully hold the reduction nut and mounting sleeve with the torch body to the side.
  - 6 Push the gear rack into the groove of the mounting tube.
- 
- The diagram illustrates the steps of installing the gear rack into the mounting tube. It shows the torch body being held to the side while the gear rack is pushed into the groove of the mounting tube.



7 Screw the mounting tube with gear rack into the reduction nut. Hold the reduction nut and the torch mounting sleeve with torch body in order not to damage the cables.

8 Tighten the mounting tube by hand.



9 Screw in the strain relief. Hold the mounting tube tight to avoid damaging the cables.

10 Tighten the strain relief by hand.

## 6.7 Installing consumables for the hand and machine cutting torches

### **⚠ WARNING**

#### **Risk of injury due to unexpected ignition of the plasma arc**


##### **Hand cutting torch:**


When the input power plug is plugged in, the plasma arc ignites immediately when the torch trigger is pressed. Individuals can be seriously injured if the arc ignites unexpectedly.

##### **Machine cutting torch:**


When the input power plug is plugged in, the plasma arc ignites immediately when the CNC start signal is ON. Individuals can be seriously injured if the arc ignites unexpectedly.

- Hold the tip of the torch away from you.
- Do not hold the workpiece to be cut tightly and keep your hands away from the cutting surface.
- Do not point the cutting torch at yourself or other individuals.
- Wear your personal protective equipment.

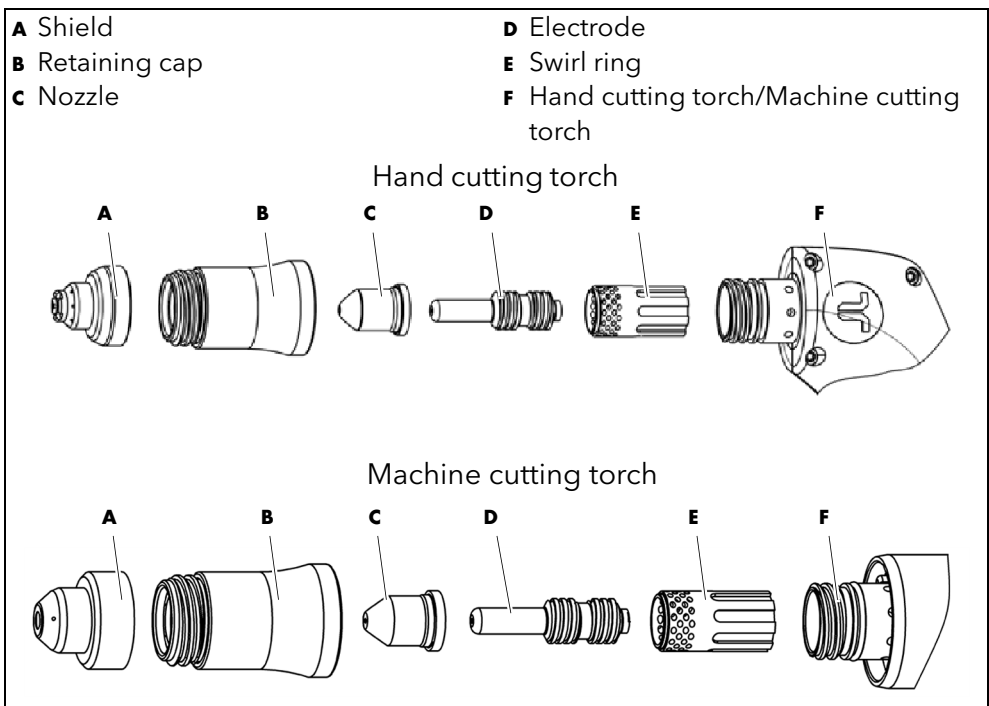


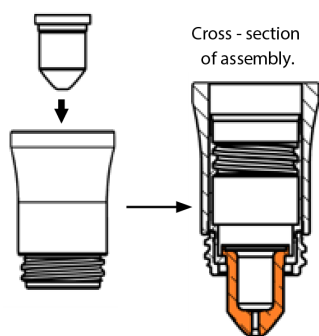


- 1 Insert the nozzle into the retaining cap.

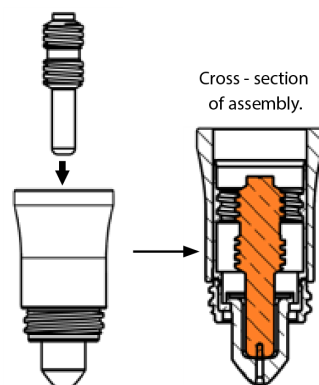


- 2 Insert the electrode into retaining cap and nozzle.

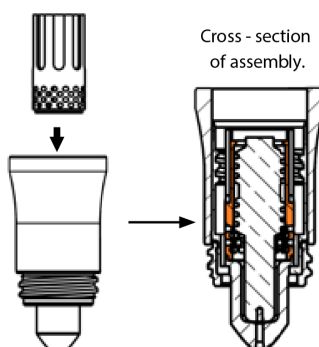

- 3 Insert the swirl ring.

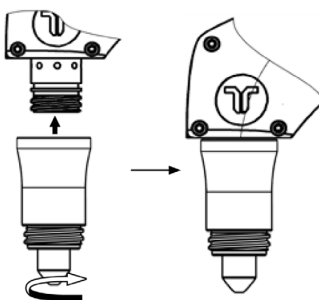


- 4 Screw the entire assembly onto the hand cutting torch.
  - Do not overtighten.
  - The nozzle must be firmly in place and must not move.

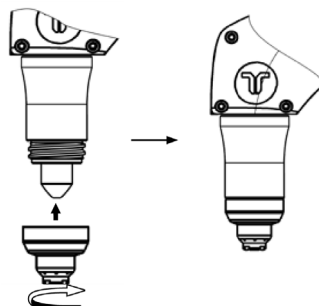

- 5 Screw on the shield and tighten it by hand.

## 6.8 Aligning FHT-EX® 105TTM machine cutting torch

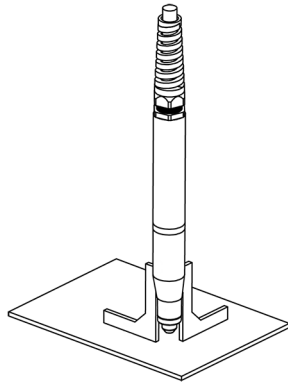

- 1 Position the cutting torch perpendicular to the workpiece.
- 2 Use an angle gauge to align the machine cutting torch at 0° and 90°.

## 7 Operation of the power supply

### **⚠ WARNING**

#### **Risk of injury due to unexpected ignition of the plasma arc**

##### **Hand cutting torch:**

When the input power plug is plugged in, the plasma arc ignites immediately when the torch trigger is pressed. Individuals can be seriously injured if the arc ignites unexpectedly.

##### **Machine cutting torch:**

When the input power plug is plugged in, the plasma arc ignites immediately when the CNC start signal is ON. Individuals can be seriously injured if the arc ignites unexpectedly.

- Hold the tip of the cutting torch away from you.
- Do not hold the workpiece to be cut tightly and keep your hands away from the cutting surface.
- Do not point the cutting torch at yourself or other individuals.
- Wear your personal protective equipment.

### **⚠ CAUTION**

#### **Risk of burns due to flying sparks when angling the cutting torch**

When the cutting torch is angled during cutting or piercing, molten metal (sparks) will escape in the direction in which the cutting torch is pointed. This may result in burns.

- Do not point the cutting torch at yourself or other individuals when angling it.
- Wear your personal protective equipment.

### **NOTICE**

#### **Material damage due to exceeding the maximum duty cycle**

If the device is operated for longer than the maximum duty cycle, it may be overloaded and irreparably damaged.

- Only operate the device up to the maximum permissible duty cycle.  
⇒ 4.2 Technical data on page EN-11
- Observe the maximum duty cycle for cutting components.

**NOTICE****Material damage caused by unplugging the input power plug during operation**


If the input power plug is unplugged during operation, the device may be irreparably damaged.

- Do not unplug the input power plug during operation and ensure a constant power supply.

**NOTICE****Material damage due to switching the output current strength during operation**

If the output current strength is switched during operation, the unit may be damaged.

- Set the output current strength before starting operation and do not switch it during the cutting process.

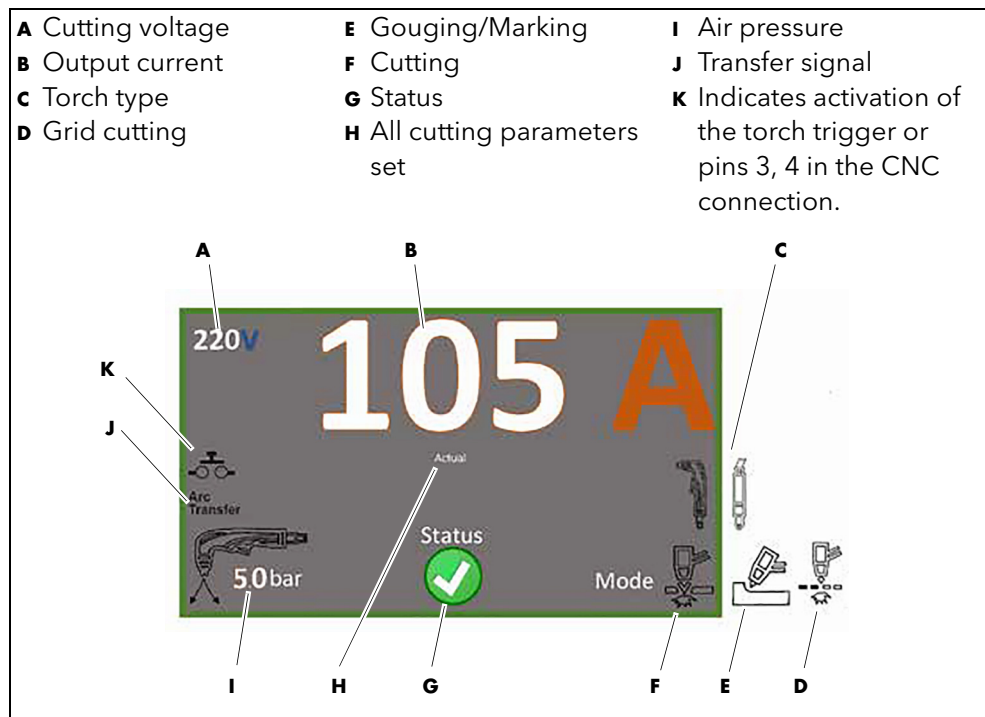**7.1 LCD description**




### 7.1.1 Setting the parameters


The LCD menu is used to set the output current (amps), cutting modes, and pressure in bar, MPa, or psi.



- 1 Press the multi-function button for one second.
  - The adjustable values as well as the word "Set" flash in red.
- 2 Press the multi-function button briefly to switch between the values.
- 3 Turn the multi-function button to the left or right to increase or decrease the values.
- 4 Press the multi-function button briefly to accept the set values.
  - Once all values are set, they are displayed in white and the word "Status" appears.

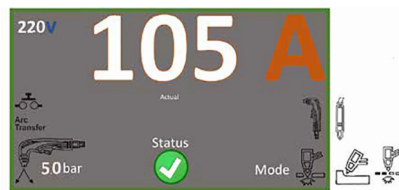

### 7.1.2 Selecting the cutting mode

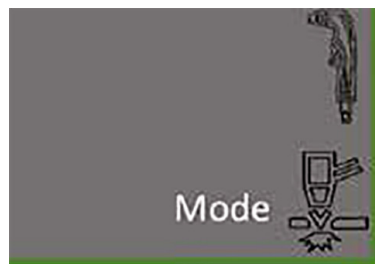

#### Cutting

The current is 20 -105 A.  
The pressure of the cutting gas is 4.8 - 5.2 bar.




#### Gouging

The current is 20 -105 A.  
The pressure of the cutting gas is 5 bar.

#### Marking

The current is 10\* - 20 A.  
The pressure of the cutting gas is 2.4 bar.

\* Optional light marking.

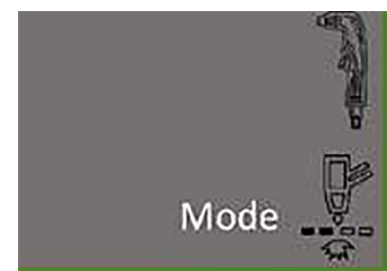


#### Grid cutting

The current is 45 - 105 A.  
The pressure of the cutting gas is 4.8 - 5.2 bar.

### 7.1.3 Connecting the work lead with the work lead clamp

- 1 Remove contamination from the workpiece.
- 2 Clamp the work lead with the work lead clamp to the workpiece so that it conducts well.
- 3 Do not clamp the work lead clamp to the material to be cut off.
- 4 Clamp the work lead with the work lead clamp as close as possible to the cutting area in order to minimize electromagnetic fields.

## 7.2 Powering on the machine

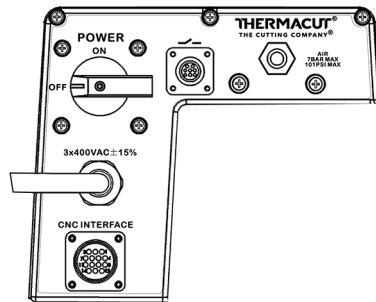

- Set the <POWER> switch to <ON>.



- The following is displayed immediately after switching on:
  - Type of power supply (105HD)
  - Length of torch cable (5, 8, 15, 23 m)
  - Type of cutting torch (hand or machine)
  - Current firmware



## 7.3 Manual cutting process

- 1 Switch on the power supply.
- 2 Automatic gas test (5 seconds).
- 3 Automatic system test (5 seconds).
- 4 Press torch trigger.
- 5 Generate a pilot arc.
- 6 Once the workpiece is detected, the pilot arc switches to a cutting arc.
- 7 The cutting process starts.
- 8 Extinguish the arc by releasing the torch trigger.
- 9 Gas post-flow period 10 - 105 seconds depending on the output current.


## 7.4 Manual grid cutting, gouging, marking process

- 1 Switch on the power supply.
- 2 Automatic gas test (5 seconds)
- 3 Automatic system test (5 seconds)
- 4 Press torch trigger.
- 5 Generate a pilot arc.
- 6 Once the workpiece is detected, the pilot arc switches to a cutting arc.
- 7 Grid cutting, gouging, or marking starts depending on the selected process.
- 8 Extinguish the arc by releasing the torch trigger.
- 9 Gas post-flow period 10 - 105 seconds depending on the output current.

## 7.5 Cutting

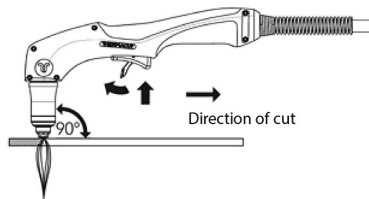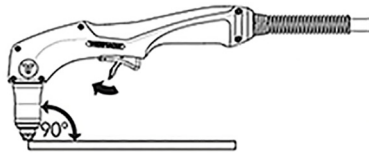


- 1 Start the cutting process at the edge of the workpiece.
- 2 Do not move the cutting torch until the material has been cut through completely.
- 3 Place the cutting torch upright on the edge of the workpiece.
- 4 Pull the cutting torch in the cutting direction. Sparks must emerge from the underside of the workpiece.
- 5 Pay attention to the following when cutting:
  - Hold the cutting torch vertically and observe the arc while cutting.
  - Make light contact between the shield and the workpiece and pull the cutting torch in the cutting direction at a constant speed.
  - For cutting thin workpieces, reduce output current strength to a minimum to achieve the highest cutting quality.
  - For cutting straight lines/bevels, use a straight edge as a guide.
  - For cutting circles, use a template or circle cutting device.

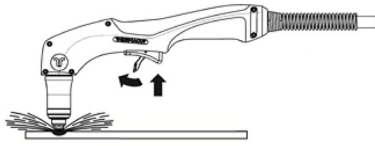

If sparks escape upwards during cutting, the material has not yet been completely severed. Proceed as follows:


- Reduce the speed at which the cutting torch is pulled.
- Check the setting for the output current.
- Check the compressed air settings.
- Check consumables for wear/damage.

## 7.6 Piercing

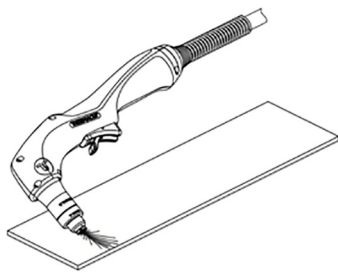


**1** Hold the cutting torch at an angle to the workpiece with a max. distance of 3 mm from the nozzle to the workpiece.

**2** Press the torch trigger to ignite the arc.

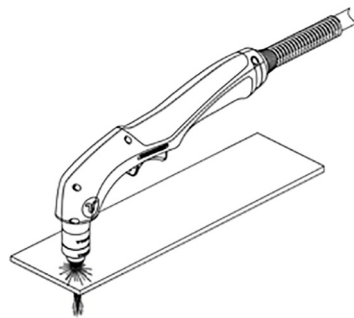

**3** Turn the cutting torch slowly in a vertical direction.

**4** Hold the cutting torch until the arc emerges from the underside of the workpiece. This indicates the material is completely pierced through.


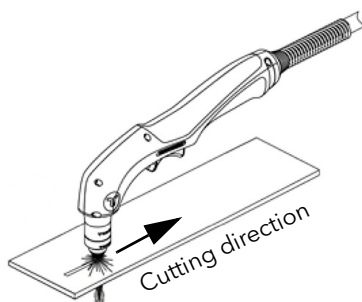


**5** Pull the cutting torch in the cutting direction. Sparks must emerge from the underside of the workpiece.

## 7.7 Gouging

Gouging can remove welding seams and achieve a controlled gouge profile. The gouge profile can be influenced by the actions in the following table:

Gouge profile	Actions
Narrower and flatter	➤ Reduce current or increase speed.
Narrower and deeper	➤ Reduce the distance between the torch and workpiece or hold the cutting torch at larger angle to workpiece.
Wider and deeper	➤ Increase current or reduce the speed.
Wider and shallower	➤ Increase the distance between the cutting torch and workpiece or hold the cutting torch at flatter angle to the workpiece.

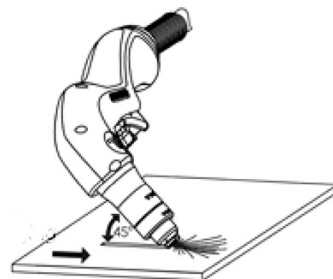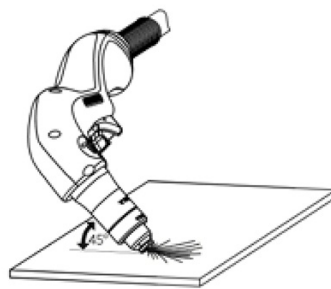

Direction of gouging

- 1 Use gouging consumables suitable to the cutting torch being used.
- 2 Hold the cutting torch at an angle of 35 - 45° inclined to the workpiece.
- 3 Hold the nozzle close enough to the workpiece so that it touches the workpiece.
- 4 Press the torch trigger to ignite the arc.
- 5 Continue to hold the cutting torch at an angle of 35 - 45° to the workpiece and move it in the direction of the material to be removed.

### 7.7.1 Table for FHT-EX® 105TT material removal

**Table 10** Table for FHT-EX® 105TT material removal

Gouging parameters			
(Dynamic) air pressure	5 bar		
Distance between cutting torch and workpiece	As close as possible		
Angle of cutting torch to workpiece	35 - 45 °		
Speed	0.6 m/min.		
Current	65 A	85 A	100 A
Removal rate for mild steels	Approx. 4.8 kg/hr	Approx. 7.74 kg/hr	Approx. 9.0 kg/hr
Width of gouge	Approx. 5.5 mm	Approx. 5.7 mm	Approx. 6.2 mm
Depth of gouge	Approx. 4.5 mm	Approx. 4.8 mm	Approx. 4.1 mm

## 7.8 Stopping the cutting process

### **⚠ CAUTION**

#### **Risk of injury due to hot parts**

Parts may still be hot after the gas post-flow period ends. People are at a risk of burns.

- Wear your personal protective equipment.
- Allow the cutting torch to cool down for 5 - 10 minutes before touching the parts.

➤ Release the torch rigger to end the cutting process.

After releasing the torch trigger, the gas continues to flow for up to 105 seconds, depending on the set output current, in order to cool the cutting torch and the consumables.

- To end the gas post-flow period prematurely, briefly press and release the torch trigger.
- Press the torch trigger again to ignite the pilot arc.

## 8 Disconnecting the unit

- 1 Set the <POWER> switch to <OFF>.
- 2 Disconnect the device from the input power supply.
- 3 Disconnect the device from the gas supply.

## 9 Maintenance and cleaning

Scheduled maintenance and cleaning are prerequisites for a long service life and trouble-free operation. The maintenance cycle is determined by the work environment and the device's maintenance intervals. If the device is operated for more than 8 hours a day, the maintenance intervals should be changed as needed. When using plasma arc cutting equipment, always observe the provisions of EN 60974-4 Inspection and testing, as well as any local laws and regulations.

### **⚠ WARNING**

#### **Electric shock due to missing grounding**

If the cover plates are improperly mounted, the grounding may not be properly established. There is a risk of life-threatening electric shock.

- The cover plates may be disassembled and assembled only by a qualified electrician for maintenance and cleaning work.
- Each time the cover plates are opened, have a safety inspection performed in accordance with DIN IEC 60974 Part 4: "Periodic inspection and testing" by Thermacut® or another authorized specialist.

### **⚠ WARNING**

#### **Electric shock due to live parts**

Fatal electric shock can occur if components are live during maintenance and cleaning work.

- Set the <POWER> switch to <OFF> before maintenance and cleaning work.
- Disconnect the input power supply.

**⚠ WARNING****Electric shock due to defective cables**

Damaged or improperly installed cables can lead to fatal electric shock.

- Check all live cables and connections for proper installation and damage.
- Damaged, deformed or worn parts should only be replaced by a qualified electrician.

**⚠ CAUTION****Fire hazard due to contamination**

Dust deposits inside the device can lead to a reduction in insulation. This can cause short circuits or fires.

- Clean the device annually with dried compressed air to remove dust and cutting fume residue.

### 9.1 Maintenance and cleaning intervals

The specified intervals are standard values and refer to single-shift operation. We recommend recording the inspections. The date of the inspection, the detected defects and the name of the inspector should be documented.

<b>Daily/every 6 hours of cutting</b>	➤ Check the gas settings.
	➤ Check cables, connector hoses, and connections for tight fit and damage, and replace if necessary.
	➤ Check the work lead clamp for contamination.
	➤ Check the cutting torch's consumables for wear.
<b>Weekly</b>	➤ Check the cap sensor.
<b>Every 3 months</b>	➤ Check the cutting torch for signs of cracks in the torch body and exposed wires.
	➤ Check the gas hose, filter elements and connections for leaks.
	➤ Open the device body and have the inside of the device cleaned with a vacuum cleaner or dry, clean compressed air by Thermacut® or a different authorized specialist.
<b>Annually and after each time the housing is opened</b>	➤ Have a safety inspection performed in accordance with DIN IEC 60974 Part 4: "Periodic inspection and testing" by Thermacut® or another authorized specialist.

Table 11 Parts inspection

Consumable	Check for	Action
Shield	➤ Orifice is not round.	➤ Replace the shield.
	➤ Spatter in the gap between the shield and the nozzle.	➤ Clean the shield and nozzle surface.
Retaining cap	➤ Heat damage, cracks, breaks, damaged threaded connections, clogged gas holes.	➤ Replace the retaining cap.
Nozzle	➤ Orifice is not round.	➤ Replace the nozzle.
Swirl ring	➤ Outer surface is damaged or dirty.	➤ Clean or replace the swirl ring.
	➤ Electrode restriction due to dirt, debris, or damage on interior surfaces.	
	➤ Clogged or damaged gas holes.	
Electrode	➤ Pit depth in hafnium is deeper than 1.6 mm.	➤ Replace the electrode.
Cutting torch	➤ Fire or arc damage inside.	➤ Replace the cutting torch.
	➤ Worn or damaged threaded connections.	
	➤ Burned or missing material.	
	➤ Cutting torch is damaged or dirty.	
	➤ Damaged O-ring.	➤ Replace the O-ring.
	➤ Dry O-ring.	➤ Apply a thin layer of silicone grease.

## 10 Faults and troubleshooting

Verify consumables selection according to:

⇒ 17 FHT-EX® 105TTH consumables for hand cutting torch on page EN-42

⇒ 19 FHT-EX® 105TTM consumables for machine cutting torch on page EN-46

➤ Contact your retailer or Thermacut® in the event of questions or problems.

Table 12 Fault messages in the display

Error code	Cause	Troubleshooting
H01	➤ Input power voltage is too low.	➤ Check the input power voltage.
H02	➤ Input power voltage is too high.	➤ Check the input power voltage.
H03	➤ No arc or current when the trigger is pressed.	➤ Check everything.



Table 12 Fault messages in the display

Error code	Cause	Troubleshooting
<b>H04</b> <Arc does not ignite when the torch trigger is pressed or the CNC start signal is switched on.>	➤ Missing nozzle or electrode.	➤ Check that the consumable is installed correctly and, if necessary, re-install it correctly or replace it.
	➤ Dirt or short circuit in the cutting torch.	➤ Dismantle all consumables, clean the inside of the cutting torch and install correctly.
	➤ Consumables are not Thermacut® original parts.	➤ Use Thermacut® original consumables.
	➤ Consumable part is loose, incorrectly installed or defective.	➤ Verify that the consumables are installed correctly and, if necessary, re-install correctly or replace them.
<b>H05</b>	➤ The electrode is not separated from the nozzle during the pilot arc.	➤ Check for free movement of the electrode and clean or replace parts, if necessary.
<b>H06</b> <Excess temperature>	➤ Fan is defective.	➤ Ensure that the fan is running freely. ➤ Replace the fan or fan motor.
	➤ Duty cycle has been exceeded.	➤ Switch off the device and allow it to cool down. ➤ Do not exceed the duty cycle.
	➤ Components defective.	➤ Contact service or your retailer.
<b>H07</b> <Excess current>	➤ Inverter overcurrent.	➤ Have the output diodes, main transformer, and IGBT on the inverter board checked by an authorized professional.

Table 12 Fault messages in the display

Error code	Cause	Troubleshooting
<b>H08</b> <Arc does not ignite when torch trigger is pressed or the CNC start signal is on>	➤ The cutting torch is missing or not connected.	➤ Verify the proper cutting torch is connected.
	➤ Consumables are loose, incorrectly installed or missing.	➤ Verify that the consumables are installed correctly and, if necessary re-install them correctly or replace them.
	➤ Retaining cap is incorrectly installed or has been tightened too tightly.	➤ Verify that the retaining cap is correctly installed, re-install correctly and tighten, if needed.
	➤ Consumables used are not Thermacut® original parts.	➤ Use only Thermacut® original consumables.
<b>H11</b>	➤ Missing phase.	➤ Have the issue checked by Thermacut® or a qualified electrician.
<b>H14</b>	➤ Incorrect cutting torch.	➤ Verify the proper cutting torch is connected.
<b>H15</b>	➤ No data communication at the BUS.	➤ Check the cable. ➤ Replace the CAN and BUS PCB. ➤ Replace the control PCB.
<b>H16</b>	➤ Data recording failed.	➤ Check the cable. ➤ Replace the CAN and BUS PCB. ➤ Replace the control PCB.
<b>H17</b> <GAS>	➤ Gas inlet pressure is below 72.5 psi (5 bar). ➤ Insufficient plasma gas flow.	➤ Check the inlet gas pressure (85 - 125 psi). ➤ Check the gas pressure and flow. ➤ Verify the gas settings are correct.
	➤ Defective torch cable.	➤ Replace the torch cable.
	➤ Pressure sensor is defective.	➤ Have the pressure switch checked and, if necessary, replaced by an authorized professional.
<b>H18</b>	➤ Watchdog fault.	➤ Replace the control PCB.
<b>H19</b>	➤ Incorrect current setting.	➤ Verify the cutting power settings.
<b>H20</b>	➤ Incorrect cutting mode.	➤ Verify the cutting mode.

Table 12 Fault messages in the display

Error code	Cause	Troubleshooting
H21	➤ Gas pressure fault	➤ Check the gas supply.
H23	➤ Torch trigger is pressed before starting or during initialization.	➤ Verify that the trigger is not pressed when the power supply is switched on and during initialization.

Table 13 General faults

Fault	Description	Cause	Troubleshooting
Switch is set to on, LCD does not illuminate.	➤ No/low input power voltage.	➤ Power supply is insufficient.	➤ Check the input power voltage.
		➤ Power cable is not connected.	➤ Plug the input power plug into the socket.
		➤ Switch is defective.	➤ Switch must be replaced by an authorized professional.
Gas does not flow when the torch trigger is pressed or the CNC start signal is switched on.	➤ Gas valve defective or missing power supply.	➤ Cable to gas valve loose or not connected.	➤ Contact your retailer.
		➤ Gas valve is defective.	➤ Contact your retailer.
Arc does not ignite and there is no fault code when torch trigger is pressed or the CNC start signal is on.	➤ Incorrect cutting torch type is connected.	➤ Cutting torch type is incorrect.	➤ Verify the proper cutting torch is connected.
	➤ Incorrect gas pressure.	➤ Consumables are defective or improperly installed.	➤ Check consumables and replace if necessary.
No transfer between pilot arc and workpiece.	➤ Poor contact between work lead clamp and workpiece.	➤ No contact between work lead clamp and workpiece.	➤ Remove contamination and/or oxidation from the workpiece and the work lead clamp. ➤ Attach the work lead clamp to the workpiece in order to allow maximum electrical conduction.
		➤ Distance between cutting torch and workpiece is too great.	➤ Decrease the distance between cutting torch and workpiece.
		➤ Work lead is defective.	➤ Have the work lead checked and, if necessary, replaced by an authorized specialist.

Table 13 General faults

Fault	Description	Cause	Troubleshooting
<p><b>Output current too low, cannot be controlled</b></p>	<p>➤ Poor contact between work lead clamp and workpiece.</p>	<p>➤ Connection fault in work lead or cutting torch cable.</p>	<p>➤ Ensure that all cable connections are correctly installed.</p>
		<p>➤ No contact between work lead clamp and workpiece.</p>	<p>➤ Remove contamination and/or oxidation from the workpiece and the work lead clamp. ➤ Attach the work lead clamp to the workpiece in order to allow maximum electrical conduction.</p>
		<p>➤ Distance between cutting torch and workpiece is too great.</p>	<p>➤ Decrease the distance between cutting torch and workpiece.</p>
	<p>➤ Voltage fault</p>	<p>➤ Faulty input voltage.</p>	<p>➤ Verify the correct input voltage according to the identification plate. ➤ Check consumables and replace if necessary.</p>
<p><b>Pilot arc ignites with difficulty and switches off.</b></p>	<p>➤ Consumables are defective.</p>	<p>➤ Consumables are worn or damaged.</p>	<p>➤ Check consumables and replace if necessary.</p>
	<p>➤ Faulty gas flow.</p>	<p>➤ Gas flow too high. ➤ Gas flow too low.</p>	<p>➤ Check gas flow settings.</p>
<p><b>Output current cannot be controlled.</b></p>	<p>➤ Poor contact between work lead clamp and workpiece.</p>	<p>➤ Connection fault. ➤ Faulty cable connections.</p>	<p>➤ Ensure that all cable connections are correctly secured. ➤ Attach the work lead clamp to the workpiece in order to allow maximum electrical conduction.</p>

Table 13 General faults

Fault	Description	Cause	Troubleshooting
Insufficient cutting quality.	➤ Incorrect setting for output current.	➤ Output current (amps) too low/material too thick.	➤ Adjust the output current strength to the thickness of the workpiece.
	➤ Consumables are defective.	➤ Consumables are worn.	➤ Inspect consumables in the cutting torch and replace if necessary.
	➤ Poor cutting quality.	➤ Incorrect cutting technology.	➤ Adjust the output current strength to the speed at which the cutting torch is pulled and thickness of the workpiece. ➤ Verify the distance between cutting torch and workpiece. ⇒ 7.5 Cutting on page EN-27
	➤ Poor contact between work lead clamp and workpiece.	➤ Workpiece is dirty.	➤ Remove contamination and/or oxidation from the workpiece and the work lead clamp. ➤ Attach the work lead clamp to the workpiece in order to allow maximum electrical conduction.

## 11 Disassembly

### WARNING

#### Electric shock due to live parts

Fatal electric shock can occur if components are live during maintenance and cleaning work.

- Set the <POWER> switch to <OFF> before maintenance and cleaning work.
- Disconnect the power supply.

- 1 Disconnect the power supply.
- 2 Disconnect all supply connections.
- 3 Remove the work lead.
- 4 Disassemble the cutting torch cable assembly.

## 12 Disposal



Equipment marked with this symbol is covered by European Directive 2012/19/EU on waste electrical and electronic equipment (WEEE).

- Do not dispose of electrical and electronic equipment with household waste.
- Disassemble electrical equipment prior to proper disposal.
  - ⇒ 11 Disassembly on page EN-37
- Collect electrical components separately and recycle in an environmentally responsible manner.
- Observe local regulations, laws, provisions, standards and guidelines.
- Please consult the responsible local authority for information about collection and return of electrical devices.

### 12.1 Disposal of materials

This product is mainly made of metallic materials that can be melted in steel and iron works and are thus almost infinitely recyclable. The plastic materials used are labeled in preparation for their sorting and separation for later recycling.

### 12.2 Disposal of consumables

Oil, greases and cleaning agents must not contaminate the ground or enter the sewage system. These substances must be stored, transported and disposed of in suitable containers. Observe the relevant local regulations and disposal instructions in the safety data sheets specified by the manufacturer of the consumables. Contaminated cleaning tools (brushes, rags, etc.) must also be disposed of in accordance with the information provided by the consumables' manufacturer.

- Observe the relevant local regulations and disposal instructions in the safety data sheets specified by the manufacturer of the consumables.

### 12.3 Packaging

Thermacut® has reduced the packaging to the necessary minimum. The ability to recycle packaging materials is always considered during their selection.


## 13 Warranty

This warranty statement is an integral part of the Terms and Conditions ("T&C") of Thermacut® (hereinafter "Seller") and applies to deliveries of goods under the contract concluded between the Seller and the other party to the contract as the recipient of the goods (hereinafter "Buyer"); the terms used herein have the same meaning as attributed to them in the T&C.

- 1 The Seller warrants to the Buyer that during the warranty period specified below, the goods delivered under the contract shall retain the properties specified in the technical data sheet for the goods available on the Seller's websites at the time the binding offer is sent (Section 2.2 of the T&C), otherwise in the quality and design suitable for the purpose resulting from the contract, otherwise for the usual purpose.
- 2 The period begins on the day of delivery of the goods to the buyer (Section 5.1, 5.2 of the T&C).
- 3 For the notification (claim) of warranty defects, the assertion of rights arising from the defective performance and other rights and obligations of the Seller and the Buyer, Section 3.4 ff and the following provisions of the T&C apply.
- 4 The warranty period is:
  - Three (3) years for EX-TRAFIRE® brand power supplies.
  - One (1) year for cutting torches and cable assemblies
- 5 The warranty does not cover normal wear and tear of the goods or their parts as a result of their use, such as nozzles, electrodes, shields, O-rings, vortex rings, etc.
- 6 The Seller shall not be liable for damage to the goods caused by the Buyer or third parties as a result of incorrect or improper handling of the goods (in particular repair or modification by persons not authorized by the Seller) or their installation, improper use of the goods or insufficient maintenance, in particular use of the goods for a purpose other than the specified purpose or other non-compliance with the operating instructions, use of excessive force or use of unauthorized goods.

14 Block diagram

Fig. 8 Block diagram

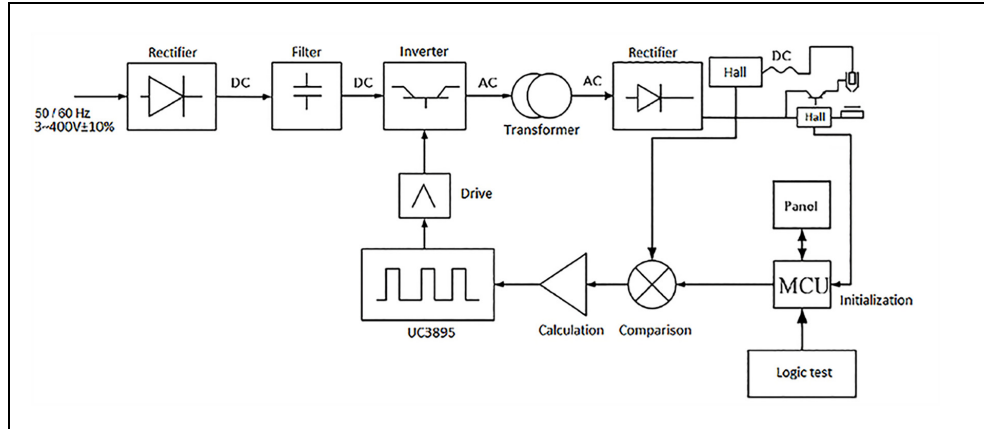

15 Accessories


Table 14 Accessories

Accessories	Part number	Description
	EX-0-802-001	DN 7.2 ES Quick-connect plug with male thread G 1/4"
	EX-0-802-002	DN 7.2 ES Quick-connect socket with male thread G 1/4"
	EX-0-803-001	CNC interface plug 14-pin kit, incl. 7 pins
	EX-0-803-004	CNC interface connection cable 6 m
	EX-0-805-001	Grease, 25 ml

For more information about accessories, visit our website:  
[www.thermacut.com](http://www.thermacut.com).



## 16 FHT-EX® 105TTH hand cutting torch unit

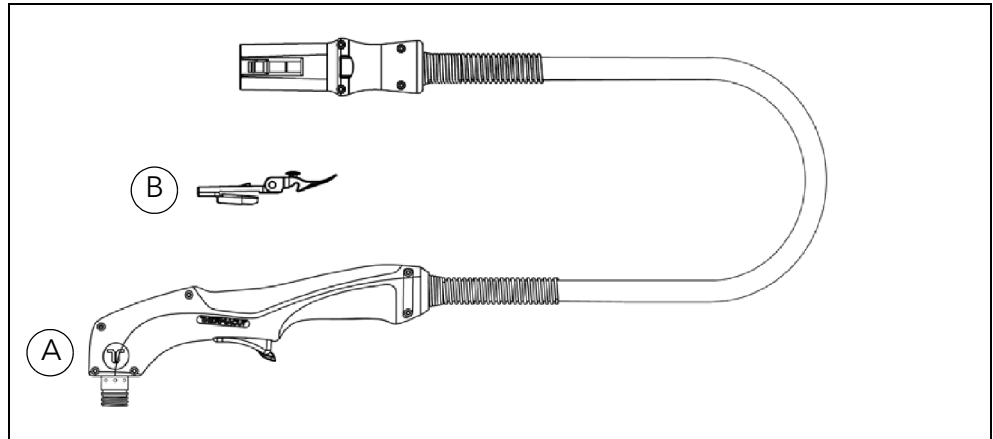


**Table 15** FHT-EX® 105TTH hand cutting torch

Number	Part number	Description
A	EX-5-133-002	FHT-EX® 105TTH hand cutting torch without consumables with 5 m (16.5') cable/TCS13
	EX-5-139-002	FHT-EX® 105TTH hand cutting torch without consumables with 8 m (26.2') cable/TCS13
	EX-5-139-003	FHT-EX® 105TTH hand cutting torch without consumables with 15 m (49.2') cable/TCS13
	EX-5-139-004	FHT-EX® 105TTH hand cutting torch without consumables with 23 m (75.5') cable/TCS13
B	EX-0-321-003	Latch with Key Assembly

## 17 FHT-EX® 105TTH consumables for hand cutting torch


### 17.1 FHT-EX® 105TTH consumables for hand cutting torch 45 - 85 A

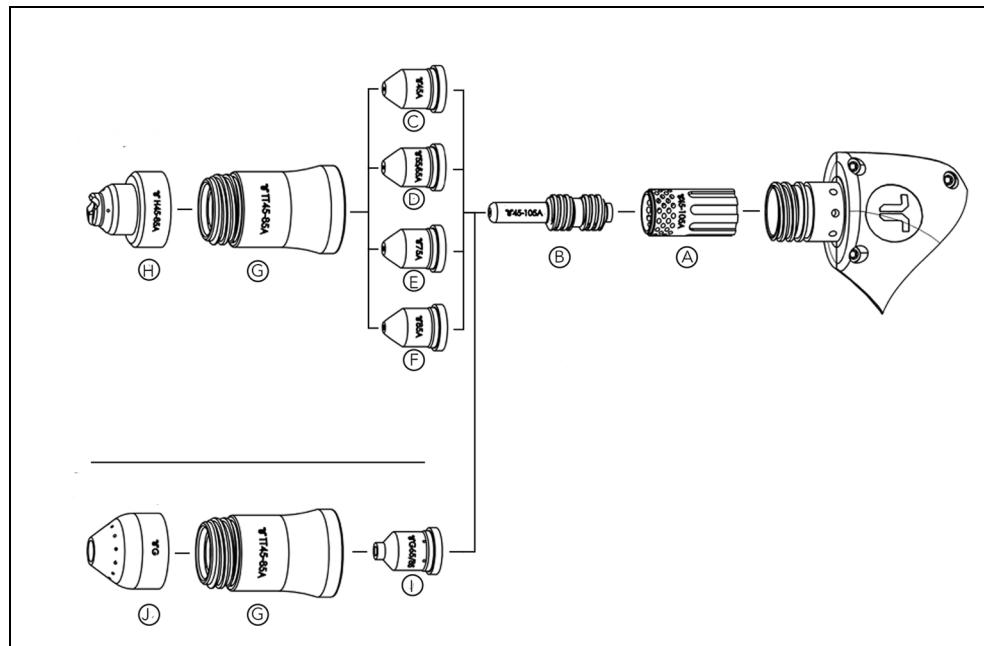

**Table 16** Consumables for hand cutting torch 45 - 85 A

Item	Part number	Description
A	EX-5-404-051	Swirl ring 45 -105 A
B	EX-5-401-051	Electrode 45 -105 A
C	EX-5-410-051	Nozzle 45 A
D	EX-5-410-053	Nozzle 55/65 A
E	EX-5-410-030	Nozzle 75 A
F	EX-5-410-055	Nozzle 85 A
G	EX-5-415-050	Retaining cap 45 - 85 A
H	EX-5-422-031	Shield 45 - 85 A
I	EX-5-440-051	Nozzle, gouging 45 - 85 A
J	EX-5-440-050	Shield, gouging


## 17.2 FHT-EX® 105TTH consumables for hand cutting torch 100 - 105 A

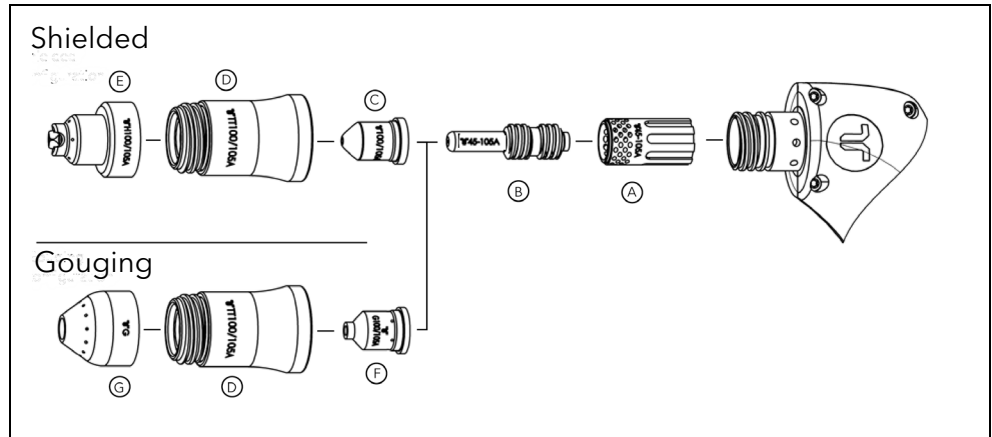

**Table 17** Consumables for hand cutting torch 100 - 105 A

Item	Part number	Description
A	EX-5-404-051	Swirl ring 45 - 105 A
B	EX-5-401-051	Electrode 45 - 105 A
C	EX-5-410-056	Nozzle 100/105 A
D	EX-5-415-051	Retaining cap 100/105 A
E	EX-5-422-032	Shield 100/105 A
F	EX-5-440-052	Nozzle, gouging 100/105 A
G	EX-5-440-050	Shield, gouging

## 17.3 FHT-EX® 105TTH consumables for SmoothLine hand cutting torch

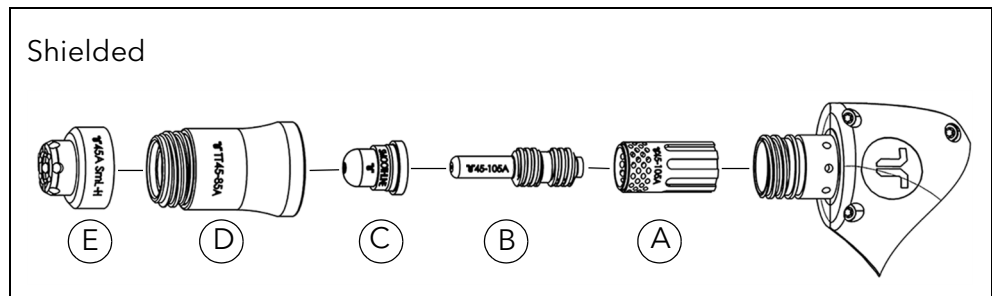


**Table 18** FHT-EX® 105TTH consumables for SmoothLine hand cutting torch

Item	Part number	Description
A	EX-5-404-051	Swirl ring 45 - 105 A
B	EX-5-401-051	Electrode 45 - 105 A
C	EX-5-410-050	Nozzle, SmoothLine
D	EX-5-415-050	Retaining cap 45/85 A
E	EX-5-420-050	Shield 40/45 A

## 18 FHT-EX<sup>®</sup> 105TTM machine cutting torch unit

### 18.1 FHT-EX<sup>®</sup> 105TTM machine cutting torch without gear rack

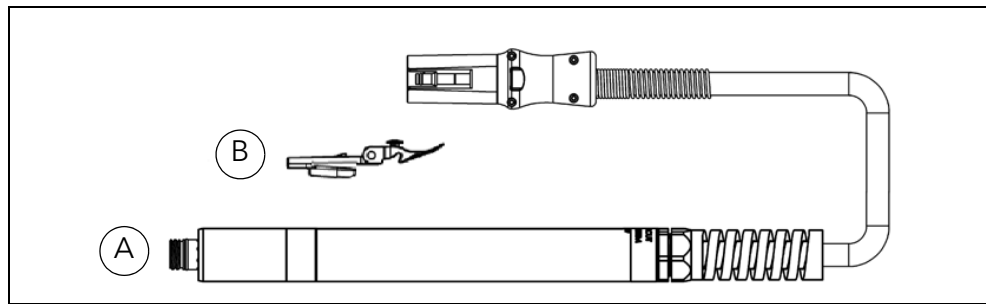

**Table 19** FHT-EX<sup>®</sup> 105TTM machine cutting torch without gear rack

Number	Part number	Description
A	EX-5-202-031	FHT-EX <sup>®</sup> 105TTM machine torch without gear rack, without consumables, with 5 m (16.5') cable/ TCS13
	EX-5-204-031	FHT-EX <sup>®</sup> 105TTM machine torch without gear rack, without consumables, with 8 m (26.2') cable/ TCS13
	EX-5-207-032	FHT-EX <sup>®</sup> 105TTM machine torch without gear rack, without consumables, with 15 m (49.2') cable/ TCS13
	EX-5-210-034	FHT-EX <sup>®</sup> 105TTM machine torch without gear rack, without consumables, with 23 m (75.5') cable/ TCS13
B	EX-0-321-003	Latch with Key Assembly

## 18.2 FHT-EX® 105TTSM short machine cutting torch


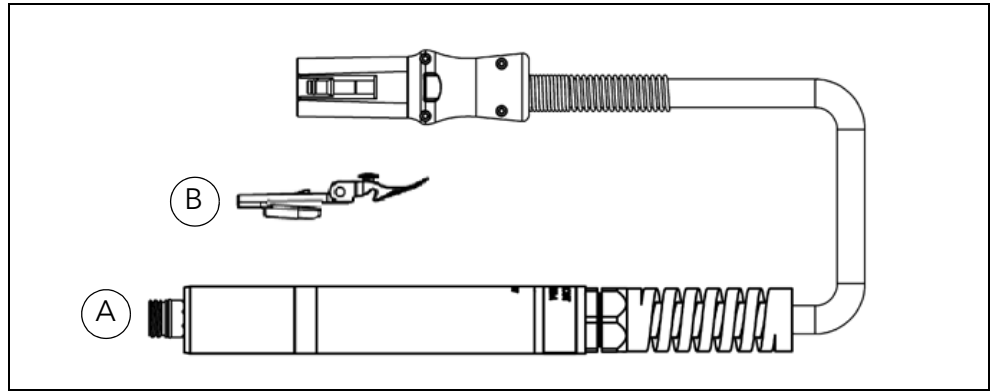


Table 20 FHT-EX® 105TTSM short machine cutting torch

Number	Part number	Description
A	EX-5-242-021	FHT-EX® 105TTSM short machine cutting torch, without consumables, with 5 m (16.5') cable/ TCS13
	EX-5-244-021	FHT-EX® 105TTSM short machine cutting torch, without consumables, with 8 m (26.2') cable/ TCS13
	EX-5-247-021	FHT-EX® 105TTSM short machine cutting torch, without consumables, with 15 m (49.2') cable/ TCS13
	EX-5-250-021	FHT-EX® 105TTSM short machine cutting torch, without consumables, with 23 m (75.5') cable/ TCS13
B	EX-0-321-003	Latch with Key Assembly

### 19 FHT-EX® 105TTM consumables for machine cutting torch

#### 19.1 FHT-EX® 105TTM consumables for standard machine cutting torch 45 - 85 A

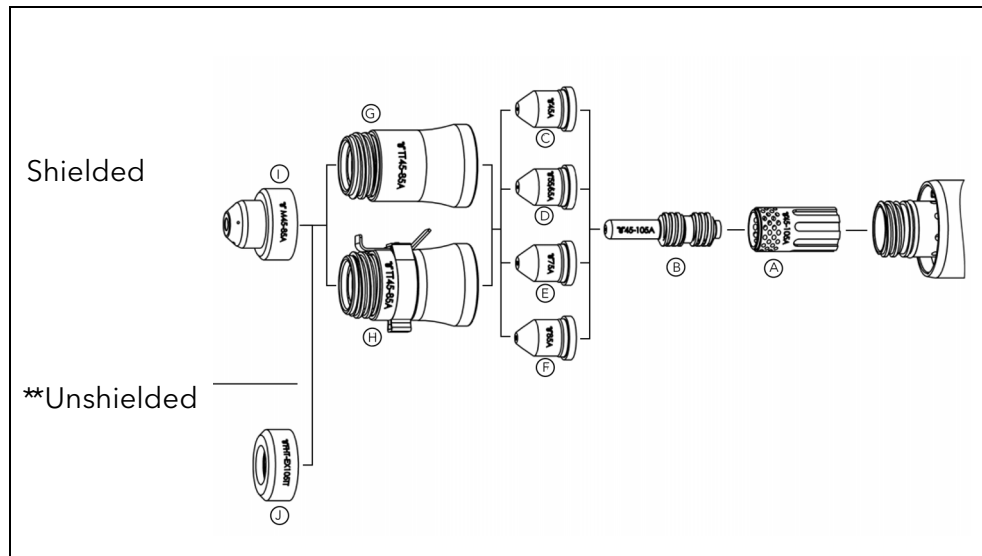


**Table 21** FHT-EX® 105TTM consumables for standard machine cutting torch 45 - 85 A

Item	Part number	Description
A	EX-5-404-051	Swirl ring 45 - 105 A
B	EX-5-401-051	Electrode 45 - 105 A
C	EX-5-410-051	Nozzle 45 A
D	EX-5-410-053	Nozzle 55/65 A
E	EX-5-410-030	Nozzle 75 A
F	EX-5-410-055	Nozzle 85 A
G	EX-5-415-050	Retaining cap 45 - 85 A
H	EX-5-415-052	Retaining cap 45 - 85 A with IHS tab
I	EX-5-422-051	Shield 45 - 85 A
J	EX-5-423-001	Deflector

➤ If a torch height controller is used, a retaining cap with IHS (initial height sensing) must be used.

\*\*When used in countries that require CE conformity, the torch must be operated with a shield.

## 19.2 FHT-EX® 105TTM consumables for standard machine cutting torch 100 - 105 A

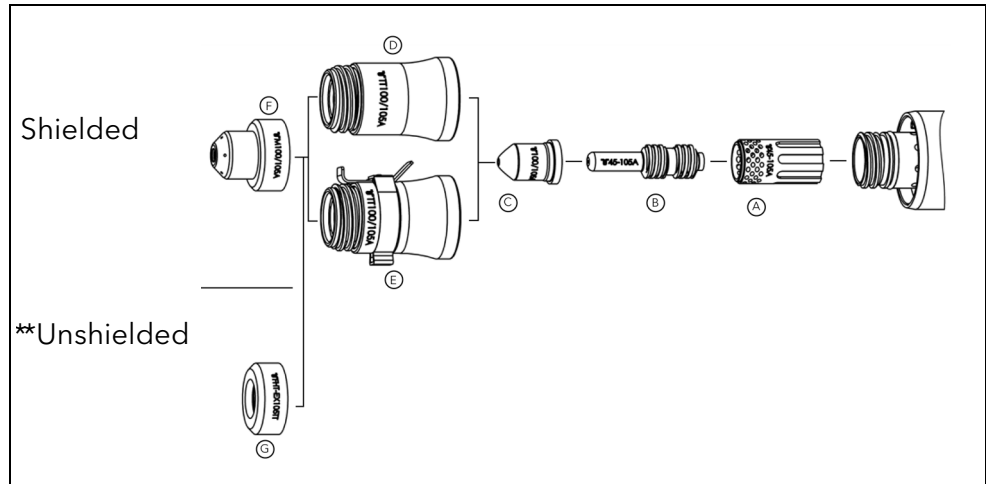


**Table 22** FHT-EX® 105TTM consumables for standard machine cutting torch 100 - 105A

Item	Part number	Description
A	EX-5-404-051	Swirl ring 45-105 A
B	EX-5-401-051	Electrode 45-105 A
C	EX-5-410-056	Nozzle 100/105 A
D	EX-5-415-051	Retaining cap100/105 A
E	EX-5-415-053	Retaining cap100/105 A with IHS tab
F	EX-5-422-052	Shield 100/105 A
G	EX-5-423-001	Deflector

➤ If a torch height controller is used, a retaining cap with IHS (initial height sensing) must be used.

\*\*When used in countries that require CE conformity, the torch must be operated with a shield.

19.3 FHT-EX® 105TTM consumables for SmoothLine machine cutting torch

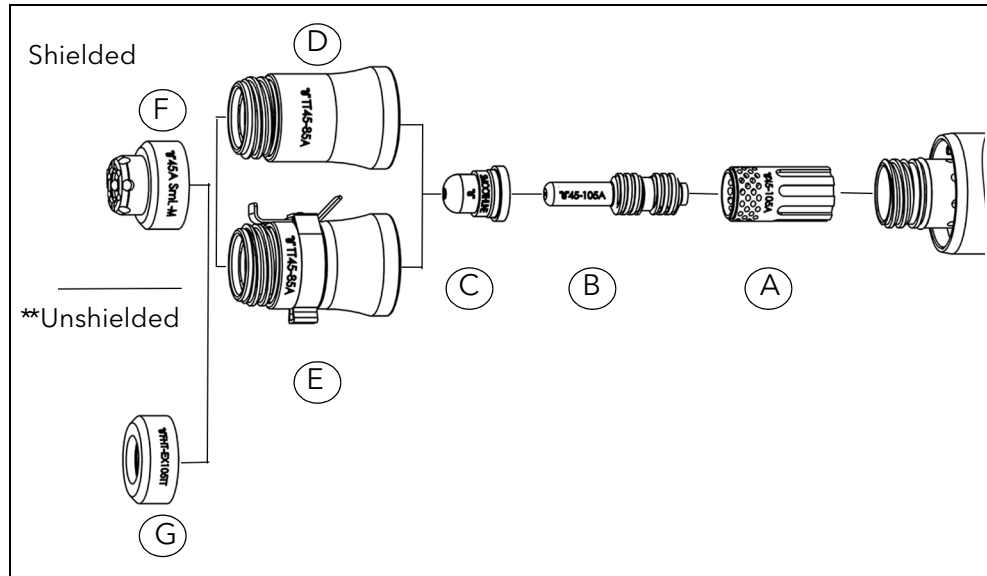

**Table 23** FHT-EX® 105TTM consumables for SmoothLine machine cutting torch


Item	Part number	Description
A	EX-5-404-051	Swirl ring 45 - 105 A
B	EX-5-401-051	Electrode 45 - 105 A
C	EX-5-410-050	Nozzle, SmoothLine
D	EX-5-415-050	Retaining cap 45 - 85 A
E	EX-5-415-052	Retaining cap 45 - 85 A with IHS tab
F	EX-5-422-050	Shield 40/45 A
G	EX-5-423-001	Deflector

➤ If a torch height controller is used, a retaining cap with IHS (initial height sensing) must be used.

\*\*When used in countries that require CE conformity, the torch must be operated with a shield.



### 19.4 FHT-EX® 105TTM consumables for marking machine cutting torch

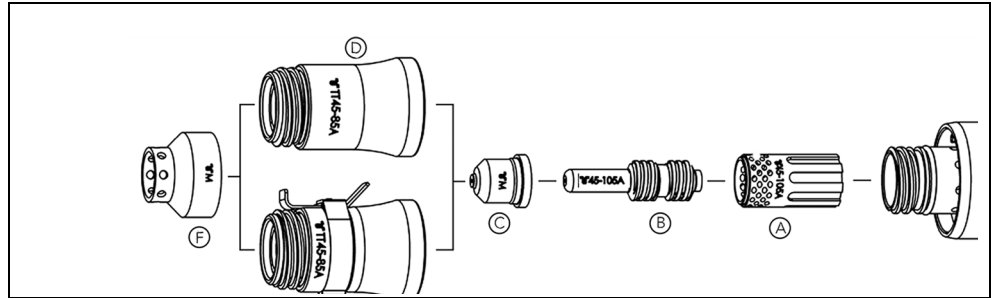

**Table 24** FHT-EX® 105TTM consumables for marking machine cutting torch

Item	Part number	Description
A	EX-5-404-051	Swirl ring 45 - 105 A
B	EX-5-401-051	Electrode 45 - 105 A
C	EX-5-445-001	Nozzle, Marking
D	EX-5-415-050	Retaining cap 45 - 85 A
E	EX-5-415-052	Retaining cap 45 - 85 A with IHS tab
F	EX-5-445-002	Shield, marking

- If a torch height controller is used, a retaining cap with IHS (initial height sensing) must be used.

## 20 Ordering information on bulk packs and starter kits

**Table 25** Bulk packs for EX-TRAFIRE® 105TTH and EX-TRAFIRE® 105TTM

Part number	Description
EX-5-401-061	Bulk pack - electrode 45 - 105 A - 25 pcs.
EX-5-410-060	Bulk pack - SmoothLine nozzle - 25 pcs.
EX-5-410-061	Bulk pack - nozzle 45 A - 25 pcs.
EX-5-410-063	Bulk pack - nozzle 55/65 A - 25 pcs.
EX-5-410-032	Bulk pack - nozzle 75 A - 25 pcs.
EX-5-410-065	Bulk pack - nozzle 85 A - 25 pcs.
EX-5-410-066	Bulk pack - nozzle 100/105 A - 25 pcs.
EX-5-422-041	Bulk pack - shield 45 - 85 A, Hand - 18 pcs.
EX-5-422-042	Bulk pack - shield 100/105 A, Hand - 18 pcs.
EX-5-422-060	Bulk pack - shield SmoothLine, Machine - 18 pcs.
EX-5-422-061	Bulk pack - shield 45 - 85 A, Machine - 18 pcs.
EX-5-422-062	Bulk pack - shield 100/105A, Machine - 18 pcs.

**Table 26** Starter Kits for EX-TRAFIRE® 105TTH and EX-TRAFIRE® 105TTM

Part number	Description
EX-5-432-051	Starter kit 55/65 A for FHT-EX® 105TTH hand torch
EX-5-432-052	Starter kit 75 A for FHT-EX® 105TTH hand torch
EX-5-432-053	Starter kit 8 A for FHT-EX® 105TTH hand torch
EX-5-432-054	Starter kit 100/105 A for FHT-EX® 105TTH hand torch
EX-5-433-051	Starter kit 55/65 A for FHT-EX® 105TTM machine torch
EX-5-433-052	Starter kit 75 A for FHT-EX® 105TTM machine torch
EX-5-433-053	Starter kit 85 A for FHT-EX® 105TTM machine torch
EX-5-433-054	Starter kit 100/105 A for FHT-EX® 105TTM machine torch

Each starter kit includes:

- 4 × Hand or machine shield
- 4 × nozzle
- 4 × electrode
- 1 × swirl ring
- 1 × O-ring - torch body

## 21 Cutting tables for mechanical cutting

Cutting tables serve as a guideline for mechanical cutting. Individual systems can be "fine tuned" to achieve optimum cutting quality.

➤ Recommended speed:

Speeds adjusted for cutting capacity do not necessarily represent maximum speeds. They are the speeds that must be achieved for the specified material thickness.


➤ Maximum speed:

The maximum cutting speeds are the result of in-depth laboratory testing. Actual cutting speeds may vary due to different cutting applications.

➤ Configuration without shield:


If consumables are used without a shield, either the torch must be manually adjusted to the working height, or the arc voltage control (AVC) settings must be selected to achieve the desired cutting quality. Distance of torch to workpiece for configuration without shield = distance of nozzle to workpiece +3 mm.

## 21.1 45 A cutting, shielded, with compressed air

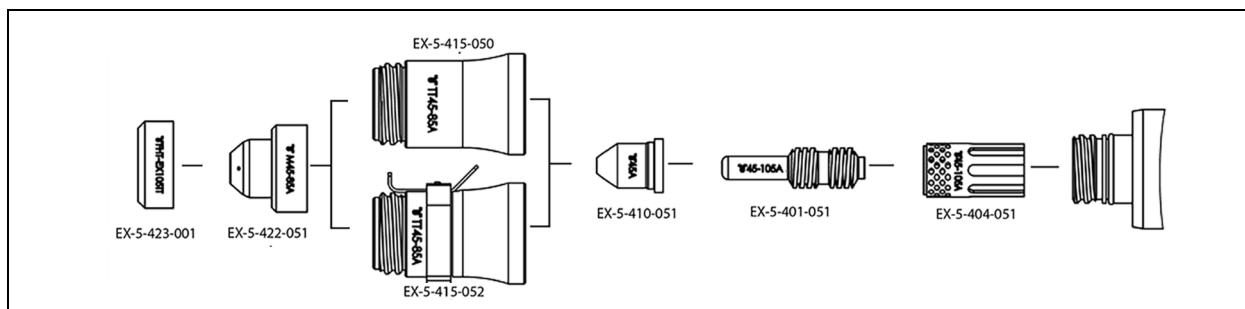


Material thickness [mm]	Torch (shield) to work-piece distance [mm]	Pierce height (shield) to workpiece distance [mm]	Pierce delay time [Seconds]	Recommended speed		Maximum speed		Kerf width [mm]
				Settings for highest quality		Standard quality settings		
				Cutting speed [mm/min]	Voltage [Volts]	Cutting speed [mm/min]	Voltage [Volts]	
<b>Mild steel</b>								
2	1.9	3.5	0.1	5600	113	6630	107	1.4
3		3.5	0.1	3950	113	4850	109	1.4
4		3.5	0.3	2900	115	3400	113	1.4
6		3.5	0.5	1500	117	1790	116	1.6
8		3.5	0.5	1050	117	1200	119	1.7
10		4	0.6	760	123	850	122	1.8
12		4.5	1	540	128	610	125	1.8
16	Edge start	/	/	290	130	340	130	2
20	/	/	/	170	139	210	136	2.2
25	/	/	/	110	146	150	142	2.2
<b>Stainless steel</b>								
2	1.9	3.5	0.1	5300	112	7600	112	1
3		3.5	0.2	3000	120	4400	119	1.3
4		3.5	0.4	1900	120	2900	120	1.4
6		3.5	0.6	1000	126	1600	120	1.6
8		4	0.6	720	128	950	124	1.6
10		4.8	0.8	500	132	750	129	1.6
12		5.2	1.2	320	136	500	132	1.8
16	Edge start	/	/	230	139	320	133	2
20	/	/	/	160	140	200	138	2
<b>Aluminum</b>								
2	1.9	3.5	0.1	7850	116	9500	115	1.1
3		3.5	0.2	4800	121	7100	118	1.5
4		3.5	0.4	3600	121	5600	120	1.5
6		3.5	0.5	2000	128	3050	125	1.5
8		3.5	0.6	1300	128	1800	125	1.6
10		4	0.7	860	132	1020	130	1.7
12		Edge start	/	0.5	620	134	745	133
16	/	/	0.5	340	134	370	137	1.7

## 21.2 55 A cutting, shielded, with compressed air

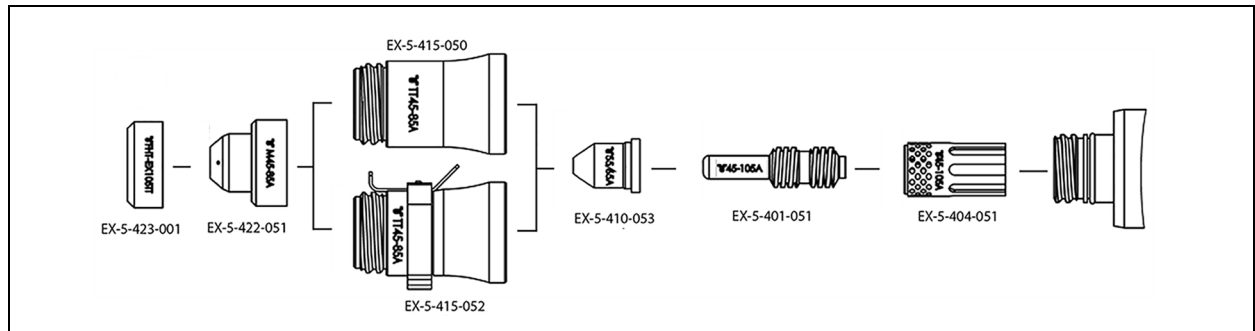


Material thickness [mm]	Torch (shield) to workpiece distance [mm]	Pierce height (shield) to workpiece distance [mm]	Pierce delay time [Seconds]	Recommended speed		Maximum speed		Kerf width [mm]
				Settings for highest quality		Standard quality settings		
				Cutting speed [mm/min]	Voltage [Volts]	Cutting speed [mm/min]	Voltage [Volts]	
<b>Mild steel</b>								
2	1.9	3.5	0.1	5270	104	6375	98	1.6
3		3.5	0.1	4250	106	4845	106	1.6
4		3.5	0.3	3485	107	3900	106	1.6
6		3.5	0.5	1785	109	2455	107	1.7
8		3.5	0.8	1445	109	1660	107	1.7
10		4	1	895	115	1105	114	1.9
12		4	1.2	740	117	825	115	2
16		4.5	1.5	510	128	575	124	2.2
18	/	/	/	415	128	475	125	2.2
20	Edge start	/	/	315	128	370	127	2.2
25	/	/	/	170	137	245	132	2.3
<b>Stainless steel</b>								
2	1.9	3.8	0.1	6800	105	8500	104	1.3
3		3.8	0.2	5525	105	6970	104	1.3
4		3.8	0.5	4250	105	5185	108	1.3
6		3.8	0.8	1995	109	2290	108	1.7
8		3.8	1	1190	115	1485	110	1.7
10		5	1.2	765	119	1020	115	2
12		7	1.3	595	121	735	118	2
16		/	/	/	400	122	460	121
18	Edge start	/	/	315	127	390	125	1.9
20	/	/	/	220	132	310	129	1.9
<b>Aluminum</b>								
2	1.9	3.5	0.1	7395	110	10000+	111	1.4
3		3.5	0.1	6120	112	7480	112	1.4
4		3.5	0.3	5100	113	6200	115	1.4
6		3.5	0.5	2550	116	3740	118	1.8
8		3.5	0.6	1530	120	2210	118	1.9
10		4	1	1020	123	1400	121	1.9
12		4	1	765	128	1100	125	1.9
16		/	/	/	550	130	590	128
18	Edge start	/	/	435	132	530	135	1.8
20	/	/	/	320	136	470	141	1.7

## 21.3 65 A cutting, shielded, with compressed air

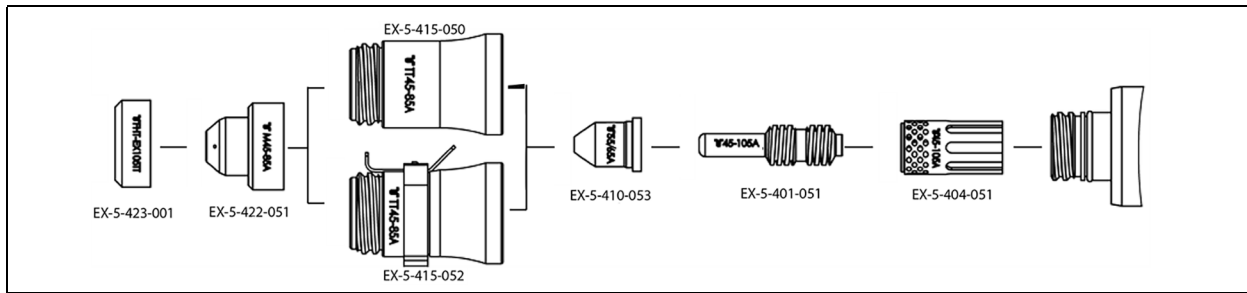

Material thickness [mm]	Torch (shield) to workpiece distance [mm]	Pierce height (shield) to workpiece distance [mm]	Pierce delay time [Seconds]	Recommended speed		Maximum speed		Kerf width [mm]
				Settings for highest quality		Standard quality settings		
				Cutting speed [mm/min]	Voltage [Volts]	Cutting speed [mm/min]	Voltage [Volts]	
<b>Mild steel</b>								
2	1.9	3.5	0.1	6200	106	7500	100	1.6
3		3.5	0.1	5000	108	5700	108	1.6
4		3.5	0.3	4100	109	4590	108	1.6
6		3.5	0.5	2100	111	2890	109	1.7
8		3.5	0.5	1700	111	1950	109	1.7
10		4	0.8	1050	117	1300	116	1.9
12		4	1	870	119	970	117	2
16		4.5	1.3	600	130	680	126	2.2
18		4.5	1.5	490	130	560	127	2.2
20	Edge start	/	/	370	130	440	129	2.2
25	/	/	/	210	139	290	134	2.3
<b>Stainless steel</b>								
2	1.9	3.8	0.1	8000	107	10000	106	1.3
3		3.8	0.2	6500	107	8200	106	1.3
4		3.8	0.5	5000	107	6100	110	1.3
6		3.8	0.5	2350	111	2700	110	1.7
8		3.8	0.8	1400	117	1750	112	1.7
10		5	1	900	121	1200	117	2
12		7	1.2	700	123	870	120	2
16		Edge start	/	/	480	124	550	123
18	/	/	/	375	129	460	127	1.9
20	/	/	/	270	134	370	131	1.9
<b>Aluminum</b>								
2	1.9	3.5	0.1	8700	112	10000+	113	1.4
3		3.5	0.1	7200	114	8800	114	1.4
4		3.5	0.3	6000	115	7300	117	1.4
6		3.5	0.4	3000	118	4400	120	1.8
8		3.5	0.5	1800	122	2600	120	1.9
10		4	0.8	1200	125	1650	123	1.9
12		4	1	900	130	1300	127	1.9
16		Edge start	/	/	650	132	700	130
18	/	/	/	515	135	630	137	1.8
20	/	/	/	380	138	560	143	1.7

## 21.4 75 A cutting, shielded, with compressed air

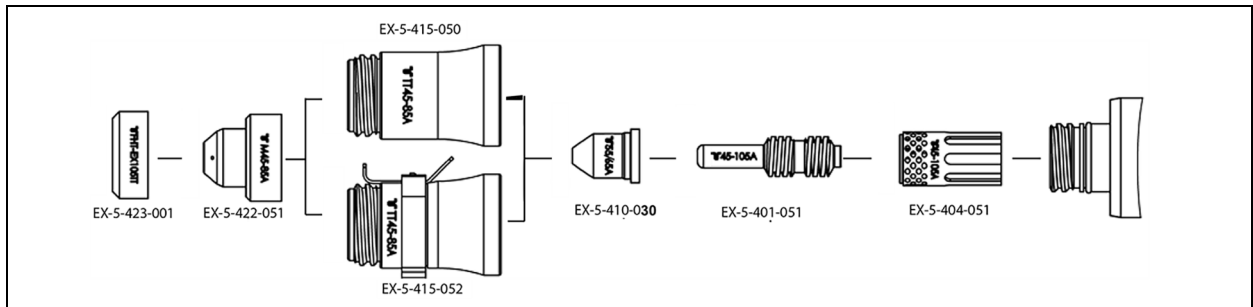


Material thickness [mm]	Torch (shield) to workpiece distance [mm]	Pierce height (shield) to workpiece distance [mm]	Pierce delay time [Seconds]	Recommended speed		Maximum speed		Kerf width [mm]
				Settings for highest quality		Standard quality settings		
				Cutting speed [mm/min]	Voltage [Volts]	Cutting speed [mm/min]	Voltage [Volts]	
<b>Mild steel</b>								
3	1.9	3.5	0.1	5700	114	6700	112	1.4
4		3.5	0.2	4400	115	5700	115	1.6
6		3.5	0.3	3400	115	4300	115	1.6
8		3.5	0.3	2100	116	2500	115	1.8
10		3.5	0.5	1400	119	1600	118	1.9
12		4	0.8	1000	121	1200	120	2.1
16		4.5	1.2	720	125	780	129	2.2
18		4.5	1.5	560	127	650	129	2.3
20	Edge start	/	/	410	130	520	129	2.3
25	/	/	/	250	137	330	135	2.3
30	/	/	/	140	143	190	140	2.5
<b>Stainless steel</b>								
3	1.9	3.5	0.2	6800	106	9000	104	1.5
4		3.5	0.3	5500	112	7200	107	1.5
6		3.5	0.5	3000	112	3800	114	1.6
8		3.5	0.5	2200	117	2400	114	1.8
10		4	0.8	1400	119	1700	114	1.8
12		5	1.2	850	128	1200	122	2
16		5	1.5	600	130	680	129	2
18		5	1.5	500	130	580	129	2
20	Edge start	/	/	380	139	500	129	2
25	/	/	/	230	134	310	132	2.2
<b>Aluminum</b>								
3	1.9	3.5	0.1	7500	110	9500	104	1.6
4		3.5	0.2	6300	117	7800	108	1.8
6		3.5	0.3	3400	120	4700	116	1.8
8		4	0.3	2300	122	3300	120	1.8
10		4	0.5	1500	126	2400	120	1.9
12		4	0.7	1200	127	1800	124	1.9
16		5	1	800	132	1100	130	2
18		Edge start	/	/	650	133	950	131
20	/	/	/	500	133	800	132	2
25	/	/	/	300	142	480	135	2.1

### 21.5 85 A cutting, shielded, with compressed air

- Recommended speed:  
Speeds adjusted for cutting capacity do not necessarily represent maximum speeds. They are the speeds that must be achieved for the specified material thickness.
- Maximum speed:  
The maximum cutting speeds are the result of in-depth laboratory testing. Actual cutting speeds may vary due to different cutting applications.
- Configuration without shield:  
If consumables are used without a shield, either the torch must be manually adjusted to the working height, or the arc voltage control (AVC) settings must be selected to achieve the desired cutting quality.  
Distance of torch to workpiece for configuration without shield = distance of nozzle to workpiece + 2.75 mm.



## 21.5.1 85 A cutting, shielded, with compressed air

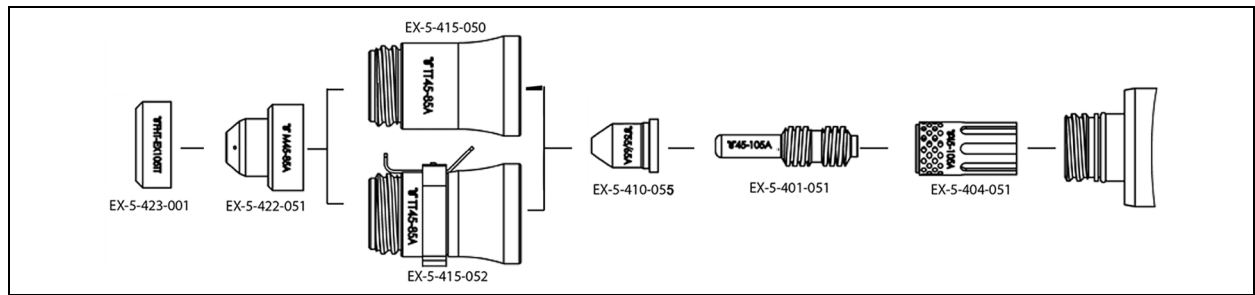


Material thickness [mm]	Torch (shield) to workpiece distance [mm]	Pierce height (shield) to workpiece distance [mm]	Pierce delay time [Seconds]	Recommended speed		Maximum speed		Kerf width [mm]
				Settings for highest quality		Standard quality settings		
				Cutting speed [mm/min]	Voltage [Volts]	Cutting speed [mm/min]	Voltage [Volts]	
<b>Mild steel</b>								
3	2.1	3.5	0.1	6400	112	7225	109	1.6
4		3.5	0.2	4700	106	3100	106	1.6
6		3.5	0.5	3100	112	3825	113	1.9
8		3.5	0.5	2400	114	2635	114	1.9
10		3.5	0.5	1600	114	1800	113	1.9
12		4	0.8	1100	120	1360	118	2.1
16		4	1	790	124	850	124	2.1
18		5	1.4	640	127	600	127	2.2
20		5	1.8	490	130	535	130	2.2
25	Edge start	/	/	320	134	366	133	2.2
30		/	/	160	141	213	138	2.6
<b>Stainless steel</b>								
3	2.1	3.5	0.2	7400	107	9200	103	1.4
4		3.5	0.5	6100	109	7500	105	1.4
6		3.5	0.5	3600	112	4600	111	1.5
8		3.5	0.5	2300	113	2800	114	1.6
10		4	0.8	1500	116	1900	116	1.9
12		5	1.2	1000	121	1300	120	1.8
16		5	1.4	700	125	760	126	2
18		5	1.8	600	127	660	126	2
20	Edge start	/	/	480	129	570	127	2.1
25		/	/	300	136	370	130	2.1
<b>Aluminum</b>								
3	2.1	3.5	0.1	8000	113	9400	110	1.6
4		3.5	0.2	6500	116	8000	115	1.6
6		4	0.5	3800	118	4900	120	1.6
8		5	0.5	2600	120	3500	120	1.7
10		6	0.5	1900	124	2500	121	2
12		7	0.7	1450	128	1900	123	2.1
16		7	1	950	134	1200	129	2.3
18		Edge start	/	/	750	136	1050	131
20		/	/	600	138	880	133	2.1
25		/	/	380	141	540	138	2.1

**21.6 100 - 105 A cutting, shielded, with compressed air**

- Recommended speed:  
Speeds adjusted for cutting capacity do not necessarily represent maximum speeds. They are the speeds that must be achieved for the specified material thickness.
- Maximum speed:  
The maximum cutting speeds are the result of in-depth laboratory testing. Actual cutting speeds may vary due to different cutting applications.
- Configuration without shield:  
If consumables are used without a shield, either the torch must be manually adjusted to the working height, or the arc voltage control (AVC) settings must be selected to achieve the desired cutting quality.  
Distance of torch to workpiece for configuration without shield = distance of nozzle to workpiece +4.55 mm.

## 21.6.1 100 - 105 A cutting, shielded, with compressed air

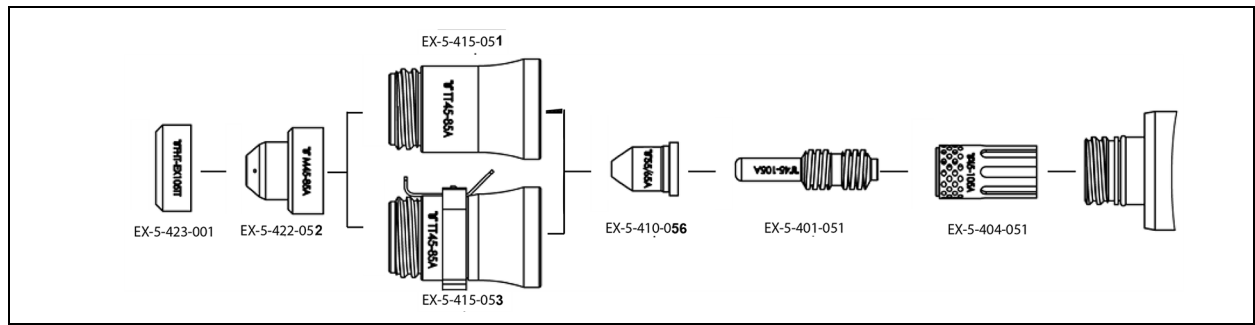


Material thickness	Torch (shield) to workpiece distance	Pierce height (shield) to workpiece distance	Pierce delay time	Recommended speed		Maximum speed		Kerf width
				Settings for highest quality		Standard quality settings		
				Cutting speed	Voltage	Cutting speed	Voltage	
[mm]	[mm]	[mm]	[Seconds]	[mm/min]	[Volts]	[mm/min]	[Volts]	[mm]
<b>Mild steel</b>								
6	3.2	6.4	0.3	4100	141	5100	143	1.9
8		6.4	0.4	3200	142	3900	142	2.3
10		6.4	0.4	2260	146	2790	147	2.3
12		6.4	0.5	1690	146	1980	145	2.5
14		6.4	1	1370	148	1640	146	2.5
16		6.4	1	1060	150	1310	147	2.6
18		6.4	1	920	152	1125	149	2.6
20		6.4	1	780	153	940	151	2.7
25	Edge start	/	/	550	154	580	152	3
30		/	/	350	162	410	162	3
35		/	/	290	162	320	162	3
40		/	/	190	170	210	172	3
<b>Stainless steel</b>								
6	3.2	6.4	0.3	4800	137	6000	136	1.8
8		6.4	0.4	3000	138	3600	137	2
10		6.4	0.5	2100	140	2500	140	2
12		6.4	0.5	1450	142	1860	141	2
16		6.4	1	920	146	1080	147	2.1
18		6.4	1	760	149	940	148	2.3
20		7	2	610	152	800	150	2.4
25		Edge start	/	/	490	156	530	152
30	/		/	310	161	350	160	2.5
32	/		/	280	161	310	159	2.5
<b>Aluminum</b>								
6	3.2	6.4	0.3	5980	143	7090	145	2
8		6.4	0.4	4170	139	5020	147	2
10		6.4	0.4	2640	150	3280	145	2.2
12		6.4	0.5	1910	149	2450	149	2.3
16		6.4	0.5	1290	154	1660	150	2.3
18		7	1	1150	156	1425	150	2.2
20		7.5	1	1020	158	1190	150	2.2
25		Edge start	/	/	660	163	790	161
30	/		/	430	169	570	167	2.7
32	/		/	340	171	490	169	2.7

**21.7 40 - 45 A cutting, SmoothLine, shielded, with compressed air**

- Recommended speed:  
Speeds adjusted for cutting capacity do not necessarily represent maximum speeds. They are the speeds that must be achieved for the specified material thickness.
- Maximum speed:  
The maximum cutting speeds are the result of in-depth laboratory testing. Actual cutting speeds may vary due to different cutting applications.
- Configuration without shield:  
If consumables are used without a shield, either the torch must be manually adjusted to the working height, or the arc voltage control (AVC) settings must be selected to achieve the desired cutting quality.  
Distance of torch to workpiece for configuration without shield = distance of nozzle to workpiece +2.15 mm.


21.7.1 40 - 45 A cutting, SmoothLine, shielded, with compressed air

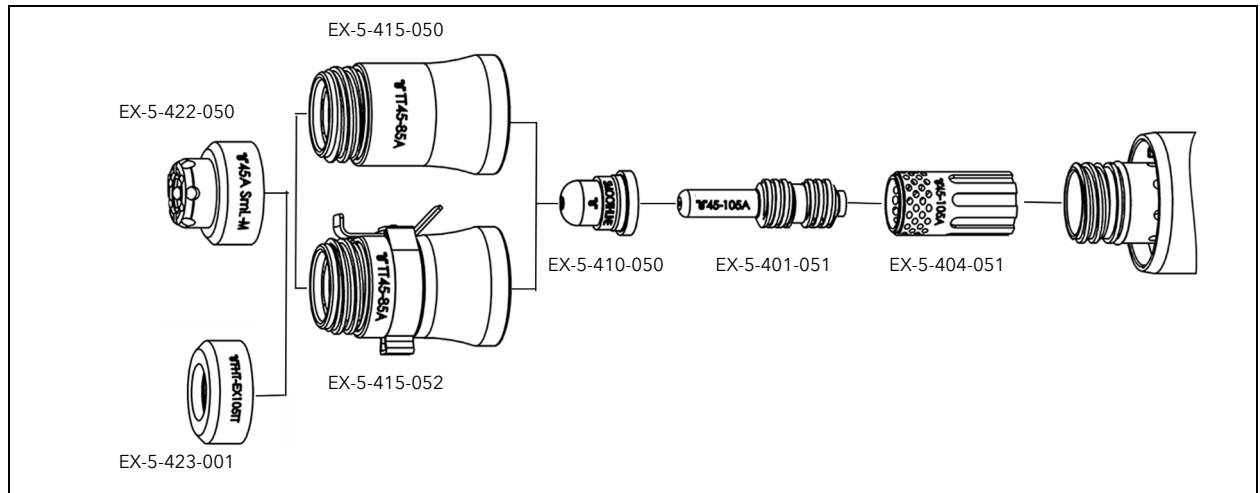

Material thickness	Torch (shield) to workpiece distance	Pierce height (shield) to workpiece distance	Pierce delay time	Recommended speed		Kerf width	Power supply
				Settings for highest quality			
				Cutting speed	Voltage		
[mm]	[mm]	[mm]	[Seconds]	[mm/min]	[Volts]	[mm]	[A]
<b>Mild steel</b>							
0.5	2	3	0	8250	76	0.7	40
0.6		3	0	8250	76	0.7	
0.8		3	0.1	8250	76	0.7	
1		3	0.2	8250	76	0.7	45
1.5		3	0.4	6400	76	0.95	
2		4	0.4	4800	80	1	
3	Edge start	3	0.5	2750	83	1.25	
4	3	0.6	1900	85	1.35		
<b>Stainless steel</b>							
0.5	2	3	0	8250	70	0.65	40
0.6		3	0	8250	70	0.65	
0.8		3	0.1	8250	70	0.65	
1		3	0.15	8250	70	0.7	45
1.5		3	0.4	6150	75	0.7	
2		3	0.4	4320	82	0.9	
3	Edge start	3	0.5	2085	94	1.1	
4	3	0.6	895	94	1.1		

21.8 Tables for marking

21.8.1 Marking, shielded, with compressed air or argon

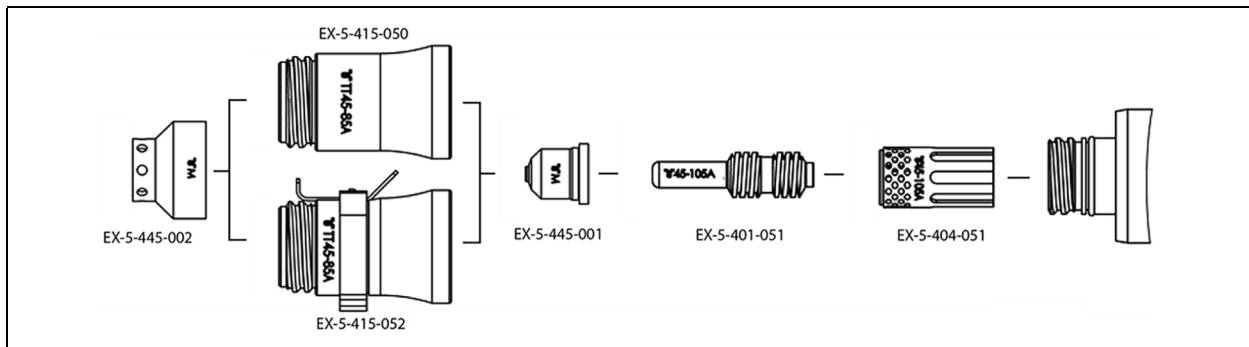

With compressed air								
Marking	Power supply	Torch (shield) to workpiece distance	Initial marking height	Delay	Marking speed	Arc voltage	Kerf width	Kerf depth
	[Amps]	[mm]	[mm]	[Seconds]	[mm/min.]	[Volts]	[mm]	[mm]
<b>Mild steel</b>								
Low	10	6.4	6.4	0	2540	127	1.4	<0.02
High	10	4.6	4.6	0	2540	109	1.62	0.02
<b>Stainless steel</b>								
Low	10	5.1	5.1	0	5080	116	1.96	0.02
High	10	6.4	6.4	0	3175	128	2.29	0.05
<b>Aluminum</b>								
	11	1	1	0	5080	80	0.92	<0.02
<b>With argon</b>								
<b>Mild steel</b>								
Marking	Power supply	Distance of torch to workpiece	Initial marking height	Delay	Marking speed	Arc voltage	Kerf width	Kerf depth
	[Amps]	[mm]	[mm]	[Seconds]	[mm/min.]	[Volts]	[mm]	[mm]
Low	10	2	2	0	3175	41	1.62	<0.02
High	15	1.5	1.5	0	3175	41	1.20	<0.02
<b>Stainless steel</b>								
Low	12	2.5	2.5	0	3175	43	1.40	<0.02
High	15	2.5	2.5	0	2540	43	1.50	<0.02
<b>Aluminum</b>								
	16	0.5	0.5	0	4445	39	0.6	<0.02

## ADDRESSES AND CONTACTS

### EUROPE

#### CZECH REPUBLIC

THERMACUT, k.s.  
Headquarters and Production  
Sokolovská 574, Mařatice  
686 01, Uherské Hradiště  
Tel.: +420 572 420 411  
Fax: +420 572 420 420  
IČ: 46963715 / DIČ: CZ46963715  
E-mail: info@thermacut.cz  
reditelstvi@thermacut.cz  
www.thermacut.cz

#### CZECH REPUBLIC

THERMACUT, k.s.  
Central Sales Department  
Dukelská 76A  
742 42 Šenov u Nového Jičína  
Tel.: +420 556 423 418, 440  
E-mail: sales@thermacut.cz  
obchod@thermacut.cz  
www.thermacut.cz

#### GERMANY

THERMACUT GmbH  
Am Rübgarten 2  
D-57299 Burbach  
Tel.: +49 (0)2736 29 49 11-0  
Fax.: +49 (0)2736 29 49 11-77  
E-mail: info@thermacut.de  
www.thermacut.de

#### CROATIA

THERMACUT CROATIA d.o.o.  
Petra Preradovića 21  
532 70 Senj  
Tel.: +385 53 882 622  
E-mail: thermacut@gs.t-com.hr  
www.thermacut.hr

#### POLAND

THERMACUT-POLAND SP. Z O.O.  
ul. Stawowa 20  
43-400 Cieszyn  
POLAND  
Tel.: +48 33 852 13 34  
E-mail: thermacut@thermacut.pl  
www.thermacut.pl

#### FRANCE

THERMACUT FRANCE  
6 Rue des Frères Lumière  
67201 Eckbolsheim  
Tel.: +33 3 88 76 58 75  
E-mail: thermacut@thermacut.fr  
www.thermacut.net

#### ROMANIA

THERMACUT ROMANIA SRL  
B-dul 1 Decembrie 1918  
nr. 127A  
540445 Targu Mures,  
Jud. Mures  
Tel.: +40 265 263 205  
Fax.: +40 265 250 317  
E-mail: office@thermacut.ro  
www.thermacut.ro

#### RUSSIA

ООО "ТЕРМАКАТ"  
454048 Г. ЧЕЛЯБИНСК  
УЛ. КИРОВОГРАДСКАЯ Д.2  
ТЕЛ./Ф АКС: +7 351 211 08 15  
**ФИЛИАЛЫ**  
129343 Г. МОСКВА  
УЛ. УРЖУМСКАЯ Д.4  
ТЕЛ.: +7 495 778 42 10  
630032 Г. НОВОСИБИРСК  
УЛ. СТАНЦИОННАЯ 60/1, ОФ ИС 116  
ТЕЛ.: +7 383 375 07 90  
E-mail: info@thermacut.ru  
www.thermacut.ru

## UKRAINE

ООО "Термакат Украина ГмбХ"  
ул. Петропавловская 24  
С. ПЕТРОПАВЛОВСКАЯ БОРЩАГОВКА  
КИЕВО-СВЯТОШИНСКИЙ Р-Н 08130  
Тел./факс: +380 44 403 16 99  
+380 50 336 33 91  
E-mail: info@thermacut.ua  
www.thermacut.ua

## GREAT BRITAIN

Abicor Binzel UK Ltd.  
Binzel House,  
Mill Lane  
Winwick Quay  
Warrington,  
WA2 8UA, Cheshire  
Tel.: +44 1925 653944  
Fax.: +44 1925 654861  
E-mail: info@abimail.co.uk  
www.thermacut.net

## NORWAY

Binzel Norge AS  
Industrievæien 6  
N-3300 Hokksund  
Tel.: 0047-32 25 19 90  
E-mail: post@binzel.no  
www.thermacut.net

## SWEDEN

Alexander Binzel AB  
Ringugnsgatan 4  
SE-216 16 Limhamn  
Tel.: 0046-40 6 991 750  
Fax: 0046-40 6 991 770  
E-mail: order@binzel.se  
www.thermacut.net

## FINLAND

ABICOR BINZEL Finland Oy  
Kartanontie 53  
28430 Pori  
Tel.: +358 2 634 4600  
Fax.: +358 2 634 4650  
E-mail: info@binzel.fi  
www.thermacut.net

## DENMARK

Abicor Binzel A/S Denmark  
Ringugnsgatan 4  
SE-216 16 Limhamn  
Tel.: 0045-43621633  
Fax.: 0045-43622324  
E-mail: ac@binzel.se,  
ket@binzel.se  
www.thermacut.net

## BELARUS

ЮОО „ABICOR BINZEL Technics“  
ул. Тимирязева 97-10  
BY-220020 Minsk  
Тел.: +375 29 5 800 300  
E-mail: info@thermacut.by  
www.thermacut.by

## SLOVAKIA

THERMACUT SLOVAKIA, s.r.o.  
Priemysel'ná ulica 1239  
931 01 Šamorín  
Tel.: +421 31 591 0121  
+421 903 644 954  
E-mail: obchod@thermacut.sk  
www.thermacut.sk

## AMERICA

### USA

THERMACUT, Inc.  
153 Charlestown Road  
Claremont, NH 03743  
Tel.: +1 (800) 932-8312  
+1 (603) 543-0585  
Fax: +1 (800) 972-6255  
+1 (603) 542-2867  
E-mail: sales@thermacut.us  
www.thermacut.com

### Mexico

BINZEL MEXICO S.A. de C.V.  
C. Municipio de Tepezalá No. 109  
de Arteaga No. 102  
Valle de Ags., C.P. 20358  
San Fco. de los Romo, Ags.  
Tel.: +52 (449) 973-0116 Ext. 115  
+52 (449) 220 6260  
Fax: +52 (449) 9731388  
E-mail: info@thermacut.com.mx  
www.thermacut.com.mx



## **BRAZIL**

BINZEL DO BRAZIL INDUSTRIAL Ltda  
Estrada Uniao e Indústria,  
Km 15,5 -Lt 17  
Pedro do Rio,  
Petrópolis - Rio de Janeiro,  
CEP 25750-226  
Tel.: +55 (24) 2222-9799  
+55 (24) 2222-9789  
+(24) 98134-2676  
Fax: +55 (24) 2222-9789  
E-mail: [thermacut@thermacut.com.br](mailto:thermacut@thermacut.com.br)  
[www.thermacut.com.br](http://www.thermacut.com.br)

## **ASIA**

### **CHINA**

TMT (Shanghai) Cutting and Welding  
Equipment Co., Ltd.  
Room 811 8/F, B Block,  
Eternal Asia Plaza,  
No. 3333 Shenjiang Road, Shanghai  
Post: 201206  
Tel.: 021-50390667  
Fax: 021-50390677  
E-mail: [thermacut@weldstone.cn](mailto:thermacut@weldstone.cn)  
[www.thermacut.cn](http://www.thermacut.cn)

### **TURKEY**

ABICOR BINZEL Kaynak Teknik  
Ticaret LTD. STI.  
Girne Mah. Irmak Sok. Küçükalyi iş  
Merkezi  
E Blok No:72-6E PK:34852  
Maltepe Istanbul Türkiye  
Tel.: +90 (216) 367 90 00  
Fax: +90 (216) 367 90 14  
E-mail: [satisdestek@binzel-abicor.com.tr](mailto:satisdestek@binzel-abicor.com.tr)  
[www.thermacuttr.com](http://www.thermacuttr.com)

### **INDIA**

ABICOR BINZEL TECHNOWELD PVT  
LTD  
SNo: 297, Indo German Technology  
park  
Village: Urawade  
Taluka: Mulshi  
District: Pune-412 115  
Tel.:020-66743914, 020-39502691  
E-mail: [commercial@abicor-india.com](mailto:commercial@abicor-india.com)  
[www.thermacut.net](http://www.thermacut.net)

### **KAZAKHSTAN**

ABICOR BINZEL CENTRAL ASIA  
АЛМАТЫ  
УЛ. ЕГИЗБАЕВА 52, 050046.  
Тел.+ 7 777 826 42 42  
+ 7 717 262 57 30  
E-mail: [info@thermacut.com.kz](mailto:info@thermacut.com.kz)  
[www.thermacut.kz](http://www.thermacut.kz)

### **VIETNAM**

MNT Industries Vietnam Co Ltd  
No. 17, Street 34, Binh Tri Dong B  
Ward,  
Binh Tan District; Hochiminh City  
Phone: 0084-903 858 001  
E-mail: [ezio.minh@mnt.com.vn](mailto:ezio.minh@mnt.com.vn)  
[www.thermacut.net](http://www.thermacut.net)

### **SOUTH KOREA**

Abicor Binzel Korea Ltd.  
#A-101, 263, Gaejwa-ro  
Guemjeong-gu  
Busan  
Tel.: 0082 (31) 732 6065 / 6066 / 6067  
Fax: 0082 (31) 732 6064  
E-mail: [don.kim@binzel.kr](mailto:don.kim@binzel.kr)  
[www.thermacut.net](http://www.thermacut.net)

---

### **JAPAN**

Thermacut Japan Ltd.  
3F Shin-Osaka Hankyu Building  
1-1-1, Miyahara, Yodogawa-ku, Osaka  
532-0003 Japan  
Mob.: +81 (0)80 4738 9752  
Tel.: +81 (0)6 7662 8857  
Fax: +81 (0)6 7635 7498  
E-mail: s.miura@thermacut.jp

### **UNITED ARAB EMIRATES**

ABICOR BINZEL MIDDLE EAST FZE  
P.O Box: 86026, WFZ-04/27  
RAKIA Freezone, Jazeera al Hamra  
Ras al Kaimah, United Arab Emirates  
Tel.: +971 (7) 2432355  
+971 50 377 1348  
Fax: +971 (7) 2432356  
E-mail: info@binzel-abicor.ae  
www.thermacut.ae

### **AUSTRALIA**

Binzel PTY Ltd.  
42 Hinkler Road  
Mordialloc  
Victoria 3195  
Tel.: +61 (0)3 9587 8522  
Fax: +61 (0)3 9580 8796  
E-mail: sales@thermacut.com.au  
www.thermacut.net

## **Revision history**

You can find the latest version of these operating instructions on our website: [www.thermacut.com](http://www.thermacut.com).

Revision R1/10\_2022

Revision R2/02\_2023:

- 4.2 „Technical data“ - Maximum input power changed to 27.1 kVA



**THERMACUT<sup>®</sup>**  
**THE CUTTING COMPANY<sup>®</sup>**

© Copyright 2022 Thermacut k.s, Subject to change without a notice.  
All Rights Reserved.