


(1) TENSE			DT-96EM / DT-72EM / DT-48EM AUTO-TUNE PID TEMPERATURE CONTROLLER			
		\wedge			T	((
		<u>'!\</u>	17			
		· · · ·	h Voltage,	Double / Reinforced	NOT	CE Mark
_	Dange	r, Warning Risk of	Electric Shock	Insulation AL SPECIFICAT	Litter ION	
_	•	Dimensions		96, DT-72EM:72x72,		
	•	Panel Cut-out		91, DT-72EM:68x68,		
	\ .	Display		ment (PV), 4 digits 7		
	∠.	Sensor Type		e T/C, Pt100 selectab		
	•	Measuring Scale	••	J type T/C (Inpt=J),		J type T/C (Inpt=J.0)
		U		, K type T/C (Inpt=k),		type T/C, (Inpt=k.0)
				T type T/C (Inpt=t),		T type T/C (Inpt=t.0)
				type T/C (Inpt=S)	0 1750 °C, R typ	
				Pt100, (Inpt=Pt)	-100.0 600.0 °C,	Pt100, (Inpt=Pt.0)
	•	Resolution	: ± 1 °C or ± 0.1			
<u>/!</u>	\mathbf{V}	Accuracy	: ± 1 % (Over fi		h-1 -	
<u> </u>	 Control Form : ON-OFF or P, PI, PD, PID - selectable Control Output : Relay (NO + NC), 250VAC, 2A, resistive load / SSR (12V) 					(10)/da 00m (1)
	•	Control Output	selectable	\cdot NC), 250VAC, 2A,	resistive load / 55	FR (12VOC, 20MA) -
	•	Heat SET		Upper Limit °C (H.Se	t)	
•	•	Heat Hysteresis		50.0 °C (H.hys); PID		
		Proportional Band	: 5 150 °C (Pl			
/!	Ν.	Integral Time	•	nin:sec. (OFF if set to	0:00)	
	<u> </u>	Derivative Time		min:sec. (OFF if set to		
	•	Control Period	: 1 200 sec. ()	
	•	Offset	,	, / -100.0 +100.0 °C	(oFFS)	
	•	Heating/Cooling	: Only heating f		, , , , , , , , , , , , , , , , , , ,	
	•	Cold. Junc. Comp.	: 0 50 °C (T/C	C)		
	\ •	Line Comp.	: 10 Ohm max.	(3 wire Pt100)		
<u> </u>				active according to F		
				, measurement out of		fails to measure
		.	input signal (OUT output is OFF if Perr is 0).			
	Supply Voltage		: 100240VAC, 50-60Hz - or (Optional; 24VDC/AC, maximum isolation voltage: 40VAC)			
		Dever Consumption	•••	IDC/AC, maximum is	olation voltage: 40V	AC)
		Power Consumption Humidity		ondonoina)		
C (Altitude	: < 70% (non-c : < 2000 m	ondensing)		
		EMC		, EN 61000-6-3 (Only	light industrial envir	ronment)
		Safety		Pollution degree 2, m		
				ustrial environment, d	-	-
	.	Protection Class	· · ·	ng to EN 60529		/
	•	Temperature Spec.		. 50 °C, Storage -10°C	C 60°C (no icing)	
	\ •	Weight	: < 0.5 kg		、 O /	
_	ム・	Torque for screwing	: Max. 0.5 N.m			
WAF	ARNING: if 2 wire Pt100 is used, connect compensation lead to measuring lead:					

WARNING: if 2 wire Pt100 is used, connect compensation lead to measuring lead:

(DT-96EM :**17-18**, DT-72EM: **13-14**, DT-48EM: **10-11**)

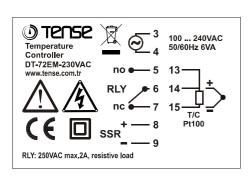

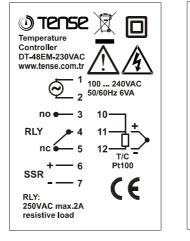

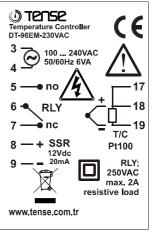



INSTALLATION, USE and WARNINGS

- This device and its packing is NOT litter and may NOT be disposed of with domestic waste. Please return this device and its packing to an appropriate recycling point at the end of its service life.
- Please read this user manual carefully and completely before installation and use. Please take into consideration all warnings mentioned in this manual.
- DT-96EM / DT-72EM / DT-48EM are suitable only for permanent panel type mounting.
- Installation and use of this device must be done by qualified, authorized and trained technical personnel only.
- Inspect device carefully before installation. Do not install and use broken and defective devices.
- Do not disassemble device. Do not make any repair on any part of the device. There is no accessible part inside the device. Please contact to manufacturer for broken and defective devices.
- Do not use device in environments subject to flammable, explosive and corrosive gases and/or substances.
 This device is designed for applications only in light industrial environments. This device is not suitable for medical and residential use. This device is not suitable for use related with human health and safety. This device is not suitable for automotive, military and marine use.
- Do not allow children and unauthorized people to use this device.
- Before installation and any technical work, disconnect the power supply and mains connections.
- Check the power supply voltage level before power on, and make sure voltage level is in specified limits. Check quality of neutral line. Improper neutral line may give permanent damage to the device.
- Connect an external power switch and an external fuse (1A, 250VAC) to the power supply line that are easily accessible for rapid intervention. Connect an external fuse (2A, 250VAC) for each relay output separately.
- Use appropriate cables for power supply and mains connections. Apply safety regulations during installation.
- Install the device in a well ventilated place. Install the device permanently into a proper panel cut-out. Fix the device with two fasteners supplied with the device. Only front panel must be accessible after installation is completed.
- Do not operate the device other then the environmental conditions given in Technical Specification.
- Do not operate the device in environments that may cause conductive pollution.
- Take precautions against negative environmental conditions like humidity, vibration, pollution and high/low temperature during installation.
- Use correct compensation cables for T/C sensors. Connect T/C cable directly to the device connectors.
- Keep device, signal cables and communication cables away from circuit breakers, power cables and devices/cables emitting electrical noise. Use shielded and twisted signal and communication cables and connect shield to earth ground on device side. Keep length of signal and communication cables less than 3m.
- In your applications, always use separate and independent mechanical and/or electromechanical devices/apparatus to support DT-96EM / DT-72EM / DT-48EM to handle emergency cases.
- Use insulated cable end-sleeves at the end of cables screwed to the device connector terminals.
- Maximum torque for screwing; 0.5 N.m.
- Please check www.tense.com.tr for latest device and documentation updates regularly. All updates and all
 information are subject to change without notice.


GENERAL SPECIFICATION

- This device is designed for basic temperature control applications only in light industrial environments.
- PID temperature controller
- Auto-tuning for PID parameters
- Sensor type: T/C (J,K,T,S,R), Pt100, selectable, multi-input
- Selectable control type: P, PI, PD, PID or ON-OFF
- Ramp mode during power on
- "Anti-windup" in PID and PI mode
- Upper and Lower limit for SET setting
- Displays SET and PROCESS values
- Cold-junction compensation for T/C
- Line compensation for Pt100
- Excellent linearity with oC/mV and oC/Ohm look-up tables
- Input "Offset" feature
- Password protection
- High accuracy
- EEPROM memory to store settings
- Easy connection with plug-in connectors





PROGRAMMING PARAMETERS

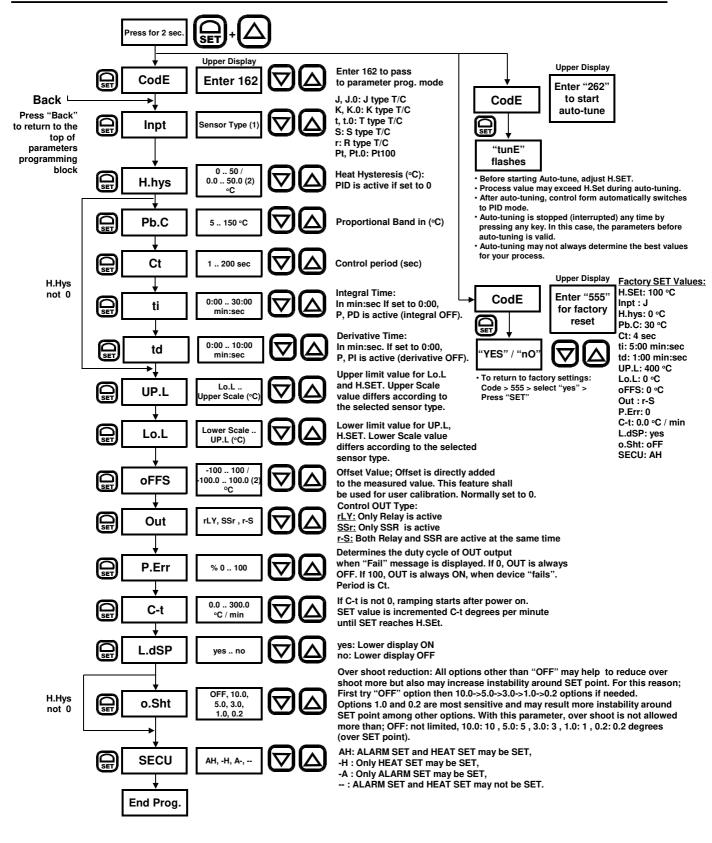

(1) When sensor type is changed, Up.L, Lo.L, H.Set, H.hys, oFFs


may be set to a new value automatically, according to the selected sensor.

(2) If sensor type is selected as Pt.0, J.0, K.0 or t.0.

Error Messages:


Fail: Sensor failure or sensor selection wrong E.FLS: Hardware failure E.CAL: Hardware failure E.EPr: Memory failure

PROGRAMMING HEAT SET

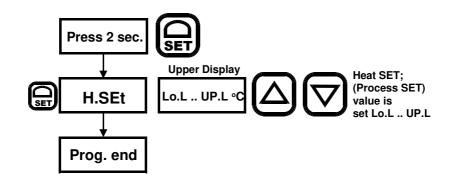

(ON-OFF CONTROL)

ON-OFF is active when "H.hys" is other then 0

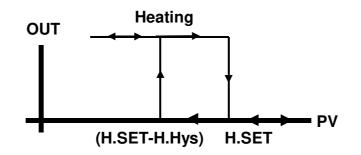

PID PARAMETERS

- P, PI, PD, PID is active when "H.hys" is set to 0.

- PbC: Proportional band in oC.

- Ct: Control period for PID control. Prefer 4-10 sec.

- <u>Ti:</u> Integral time; Set in minutes. Determines how fast controller reacts to compensate the offset between SET point and the process value. If set to 0, integral part is OFF. If set too low, process value may oscillate.

- <u>Td:</u> Derivative time; Set in minutes. If set to 0, derivative part is OFF. Determines how sensitive the controller is to changes of the offset between SET point and the process value. If set too high, process value may oscillate or overshoot.

CLAEANING

Do not use any solvents (alcohol, thinners, benzine, acid, etc.) or corrosive substances to clean the device. Use only a dry and clean non-abrasive cloth. Before cleaning, disconnect the power supply and mains connections.

